

Property address	Ardpeater
	Caledonian Crescent Gleneagles Auchterarcler
	Auchterärder PH3 ING
	PTIS TIVE

Owner (s) of Property (name)	AMG Group Ltd
------------------------------	---------------

Completion date of property questionnaire	03 08 2023
---	------------

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership				
	How long have you owned the property? Not known				
2.	Council tax				
	Which Council Tax band is your property in? (Please tick one) ☐ A ☐ B ☐ C ☐ D ☐ E ☐ F ☑ G ☐ H				
3.	Parking				
	What are the arrangements for parking at your property? (Please tick all that apply)				
	• Garage				
	Allocated parking space				
	• Driveway				
	Shared parking				
	On street				
	Resident permit				
	Metered parking				
	Other (please specify):				
4.	Conservation area				
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?				

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☑ No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	☐ Yes ☐ No
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	☐ Yes ☑ No
	(i) Were the replacements the same shape and type as the ones you replaced?	☐ Yes ☐ No
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes ☐ No
	(iii) Please describe the changes made to the windows doors, or patio approximate dates when the work was completed):	doors (with
	Please give any guarantees which you received for this work to your so agent.	olicitor or estate

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	Yes No Partial Oil Central Heating
	If you have answered yes, please answer the three questions below: (i) When was your central heating system or partial central heating. Not known	g system installed?
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract:	□ Yes □ No Unknown
	(iii) When was your maintenance agreement last renewed? (Please and year). Unlenaum	provide the month
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	✓ Yes
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes ☑ No ☐ Yes ☐ No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ☑ No

10.	Services			la mesa se			
a. P	Please tick which services are connected to your property and give details of the supplie						
	Services	Connected	Supplier				
	Gas or liquid petroleum gas						
	Water mains or private water supply						
	Electricity						
	Mains drainage	✓					
	Telephone						
	Cable TV or satellite	**************************************					
	Broadband						
b.	Is there a septic tank system a			Yes			
	If you have answered yes, plea			No			
	(iv) Do you have appropriate consents for the discharge from you septic tank?			☐ Yes ☐ No ☐ Don't Know			
	(v) Do you have a mainten If you have answered yes, plea which you have a maintenance	☐ Yes ☐ No					

11.	Responsibilities for shared or common areas	commed .96
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	☐ Yes ☐ No ☑ Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	☐ Yes No ☐ Not applicable
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	☐ Yes No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	☐ Yes No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	☐ Yes

12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	☐ Yes ☐ No
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	☐ Yes ☐ No ☐ Don't Know ☐ Yes ☐ No
c.	Please give details of any other charges you have to pay on a regular lupkeep of common areas or repair works, for example to a residents' a	
	maintenance or stair fund.	association, or
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ☐ No Not known
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	Yes No Not known
c.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	☐ Yes ☐ No

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work			U		
(ii)	Roofing					
(iii)	Central heating					
(iv)	National House Building Council (NHBC)					
(v)	Damp course					
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)					
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:				□ Yes □ No Not knaun	
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:				Yes No Don't kn	ow

16.	Notices tha	t affect your pro	perty		
	In the past th	ree years have you	ever received a notice:		
a.	advising that planning appl		hbouring property has m	ade a	Yes No Wot known
b.	that affects ye	our property in som	e other way?		☐ Yes ☐ No Notknawn
c.	that requires to your prope		tenance, repairs or impro	ovements	☐ Yes ☐ No Not known
	estate agent,		<u>of a–c</u> above, please give es which arrive at any tin		
I/ W	e confirm th		ther authorised body on in this form is tru		• •
Sign	ature(s):	_			
Data		03/08/2013			

6 e (' T

Energy Performance Certificate (EPC)

Dwellings

Scotland

ARDPEATON, CALEDONIAN CRESCENT, GLENEAGLES, AUCHTERARDER, PH3 1NG

Dwelling type:Detached houseDate of assessment:03 July 2023Date of certificate:05 July 2023Total floor area:237 m²

Primary Energy Indicator: 258 kWh/m²/year

Reference number: 0180-2387-5030-2807-3925
Type of assessment: RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£15,537	See your recommendations
Over 3 years you could save*	£6,342	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

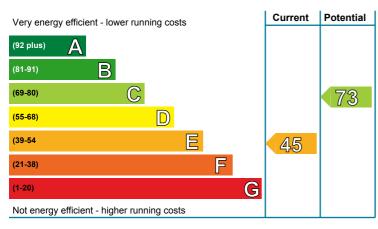


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (45)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

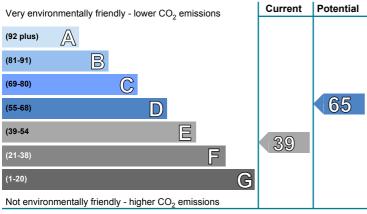

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (39)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£3396.00
2 Cavity wall insulation	£500 - £1,500	£840.00
3 Floor insulation (suspended floor)	£800 - £1,200	£1293.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	***	***
Roof	Pitched, 300 mm loft insulation Roof room(s), limited insulation (assumed)	**** **☆☆☆	**** ***
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	★★★☆☆	***
Main heating	Boiler and radiators, oil	***	***
Main heating controls	Programmer, room thermostat and TRVs	****	****
Secondary heating	None	_	_
Hot water	From main system	***	***
Lighting	Low energy lighting in 6% of fixed outlets	***	***

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO_2 emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 68 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 16 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 7.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£12,906 over 3 years	£7,473 over 3 years	
Hot water	£1,191 over 3 years	£981 over 3 years	You could
Lighting	£1,440 over 3 years	£741 over 3 years	save £6,342
Total	s £15,537	£9,195	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

D.	assumented massives	Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Room-in-roof insulation	£1,500 - £2,700	£1132	D 58	E 49
2	Cavity wall insulation	£500 - £1,500	£280	D 61	E 53
3	Floor insulation (suspended floor)	£800 - £1,200	£431	D 66	D 58
4	Low energy lighting for all fixed outlets	£85	£200	D 67	D 59
5	Solar water heating	£4,000 - £6,000	£70	D 68	D 61
6	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£567	C 73	D 65

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

5 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	42,257	N/A	(2,480)	N/A
Water heating (kWh per year)	3,838			

<u>Addendum</u>

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Andrew Little Assessor membership number: EES/021268

Connells Survey & Valuation Company name/trading name:

Address: 16-20 Hockliffe St

Bedfordshire Leighton Buzzard LU7 1GN

01525 218601 Phone number: Email address: umc@connells.co.uk Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

ARDPEATON, CALEDONIAN CRESCENT, GLENEAGLES, AUCHTERARDER, PH3 1NG 05 July 2023 RRN: 0180-2387-5030-2807-3925 **Recommendations Report**

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



survey report on:

	-
Property address	Ardpeaton, Caledonian Crescent, Gleneagles, Auchterarder, Perth and Kinross, PH3 1NG
Customer	AMG
Customer address	
Prepared by	Connells Survey & Valuation Ltd
Date of inspection	3rd July 2023



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.


The subjects under report comprise a purpose built two storey detached dwelling house.
Ground Floor: Entrance Vestibule and Hallway, Lounge, Dining Room, Sitting Room, Family Room, Kitchen, Utility Room and W.C. First Floor: Four Bedrooms and Bathroom.
circa 237 sq m
Caledonian Crescent is positioned opposite the main entrance of the Gleneagles Hotel and adjacent to the hotel's PGA National Golf Academy, and close to the small town of Auchterarder. The subjects under report are located on the north most side of Caledonian Crescent within an established and desirable residential location. All main facilities are reasonably convenient within Auchterarder.
c. 1920
Dry and bright
Visually inspected with the aid of binoculars where appropriate.
There are two brick chimneyheads to the main roof.
Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Roofing including roof space	The main roof is pitched and clay tiled. Only limited head and shoulders inspections of parts of the main roof space and eaves spaces were undertaken from various hatches at the upper floor level. Restricted accessibility due to the size/nature of the roof/eaves spaces, storage items and quantity of insulation.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Gutters and downpipes are of cast iron design.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main external walls appear and are assumed to be of traditional brick construction, predominantly harled externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Timber sealed unit double glazed installations. Timber main entrance doors.
External decorations	Visually inspected.
	Timber finishes.
Conservatories / porches	Not applicable
Communal areas	Not applicable
Garages and permanent outbuildings	Visually inspected.
	There is a single detached garage of brick, harled construction with
	pitched and clay tiled roof.
Outside areas and boundaries	visually inspected.

Ceilings	Visually inspected from floor level.
	Predominantly plastered finishes.
Internal walls	Visually inspected from floor level.
memar wans	
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Predominantly plastered finishes.
Floors including sub floors	Solid and suspended timber construction. No access obtained to inspect any sub floor areas.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal joinery is generally in keeping with the age and type of property. There is a kitchen with wall and base units.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There are various fireplaces installed within the property.
Internal decorations	Visually inspected.
	Mixed decorative finishes.
Cellars	Not applicable
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. The property appears connected to mains supplies of electricity. However, this appeared to be switched off at the time of our inspection.
Gas	Not applicable

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	The property appears connected to mains supplies of water. However, this appeared to be turned off at the time of our inspection. The plumbing and fittings appear of copper/pvc piping where seen. There is a three piece suite within the bathroom.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	There is an oil fired central heating system served by a floor mounted boiler within the Utility Room. This in turn appears to provide the domestic hot water supply. However, this appeared to be switched off at the time of our inspection.
Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Assumed mains connection.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	appliances. No tests, checks or enquires into compliance have been made.
Any additional limits to inspection	appliances.
Any additional limits to inspection	appliances. No tests, checks or enquires into compliance have been made. The property was vacant at the time of inspection which was restricted to exposed and accessible surface fabric. There were
Any additional limits to inspection	appliances. No tests, checks or enquires into compliance have been made. The property was vacant at the time of inspection which was restricted to exposed and accessible surface fabric. There were fitted floor coverings throughout. Restricted inspection was possible only of main roof structure and
Any additional limits to inspection	appliances. No tests, checks or enquires into compliance have been made. The property was vacant at the time of inspection which was restricted to exposed and accessible surface fabric. There were fitted floor coverings throughout. Restricted inspection was possible only of main roof structure and chimneystacks from ground/street level.

Sectional Diagram showing elements of a typical house

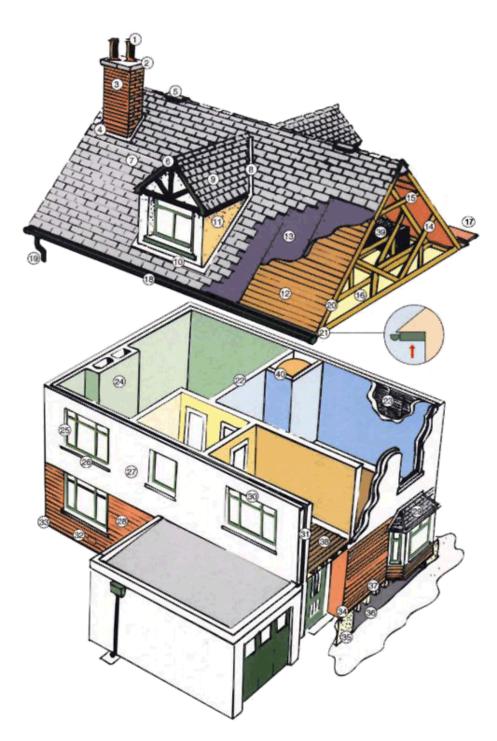

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- 13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- 17) Parapet gutter
- (18) Eaves guttering
- 19 Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
 - 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement		
Repair category	1	
Notes	There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.	

Dampness, rot and infestation	
Repair category	3
Notes	There is evidence of dampness and mould growth within the property. Woodworm was also noted. It is recommended that a reputable timber/damp specialist firm be employed to carry out a detailed inspection of the entire subjects and thereafter implement all necessary remedial works under cover of long term guarantee. This should include a full inspection of roof/eaves spaces and any sub floor areas.

Chimney stacks	
Repair category	3
Notes	There is evidence of damp staining around chimneybreasts internally. Checks and repairs are required.

Roofing including roof space	
Repair category	3
Notes	The roof is old and water ingress was noted. Heavy moss growth noted to roof coverings externally.
	It is recommended that a reputable roofing contractor is employed to inspect the roof including roof/eaves spaces and provide a report on the condition/repairing costs prior to purchase.
	It is reiterated that only limited head and shoulders inspections of the roof/eaves spaces were undertaken.

Rainwater fittings	
Repair category	3
Notes	There is evidence of blocked rainwater goods, corrosion and leakage.

Main walls	
Repair category	3
Notes	The external harling is defective in places with cracked and boss sections being evident.
	Staining noted to the external wall surfaces - leaking gutters and downpipes can result in damp penetration of the main structure.

Windows, external doors and joinery	
Repair category	3
Notes	The installations are of an older type. Seals to some of the double glazed windows have failed causing condensation between the panes.
	The external joinery is weathered and timber decay was noted.

External decorations	
Repair category	3
Notes	Overhaul/repair works are required to external decorative finishes.

Conservatories/porches	
Repair category	-
Notes	Not applicable

Communal areas	
Repair category	-
Notes	Not applicable

Garages and permanent outbuildings	
Repair category	3
Notes	The garage is in poor condition and should be repaired to bring it to an acceptable standard for its purpose.

Outside areas and boundaries	
Repair category	3
Notes	Outside areas will require repairs and maintenance.
	Boundary fencing and walls will require repairs and maintenance.
	There are a number of large trees within close proximity to the property and specialist advice on these is recommended.

Ceilings	
Repair category	3
Notes	Ceilings within the property are in very poor condition and repairs/replacement are required. Collapsed ceilings were noted and there is a risk of further collapse.

Internal walls	
Repair category	3
Notes	Internal walls within the property are in poor condition.

Floors including sub-floors	
Repair category	3
Notes	Areas of loose/uneven flooring were noted.
	Flooring is damaged within the property.
	A full inspection of any sub floor areas is recommended prior to purchase.

Internal joinery and kitchen fittings	
Repair category	3
Notes	Internal joinerywork is in need of upgrading/repairs.
	Kitchen fittings are worn and dated.
	Any non safety glass internally should be upgraded.

Chimney breasts and fireplaces	
Repair category	3
Notes	There are various fireplaces installed within the property. It should be emphasised that the flues were not checked nor appliances tested.
	There is evidence of damp staining around chimneybreasts internally. Checks and repairs are required.

Internal decorations	
Repair category	3
Notes	Internal decorations are poor throughout and repairs are required prior to redecoration.

Cellars	
Repair category	-
Notes	Not applicable

Electricity	
Repair category	3
Notes	The property is empty. The electrical installation is dated and appears to have been switched off. We would recommend that it be checked/upgraded as necessary by an NICEIC registered electrical contractor. The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

Ø Gas	
Repair category	-
Notes	Not applicable

Water, plumbing and bathroom fittings	
Repair category	3
Notes	The property is empty. Water supplies/installations may be turned off. Internal

► Water, plumbing and bathroom fittings	
Repair category	3
Notes	plumbing works comprise a mixture of copper and pvc fittings. There is the possibility of old style sections in concealed areas and it would be prudent to budget for upgrading in conjunction with other modernisation works. The sanitary fittings are in poor condition. There appears to have been a plumbing leak from the bathroom. Checks/repairs required.

Heating and hot water	
Repair category	3
Notes	An oil fired central heating system has been installed. This appeared to be of an older type and was switched off at the time of our inspection. This should be checked/upgraded by an appropriate registered tradesman.

Drainage	
Repair category	2
Notes	The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.
	The property appears to have been unoccupied for some time and the drainage system should be fully checked.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	3
Roofing including roof space	3
Rainwater fittings	3
Main walls	3
Windows, external doors and joinery	3
External decorations	3
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	3
Outside areas and boundaries	3
Ceilings	3
Internal walls	3
Floors including sub-floors	3
Internal joinery and kitchen fittings	3
Chimney breasts and fireplaces	3
Internal decorations	3
Cellars	-
Electricity	3
Gas	-
Water, plumbing and bathroom fittings	3
Heating and hot water	3
Drainage	2

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The Valuation below is made on the assumption that full certification has been obtained in respect of any alterations which may have been carried out to the property. We are not aware of any alterations.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

As of February 2022 it is now a legal requirement to have interlinked smoke and heat alarms and where appropriate a carbon monoxide detector. This report and the valuation assumes full compliance with these requirements and the legal advisors should confirm. In the event of non- compliance the value will not be materially affected as this is regarded as a legal matter.

It is recommended that where repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves for potential costs of the extent of the works required prior to submitting a legal offer to purchase.

Estimated reinstatement cost for insurance purposes

We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £750,000.

Valuation and market comments	

Market Value assuming vacant possession is £1,100,000.

igned	Security Print Code [406592 = 6351] Electronically signed
-------	---

Report author	A Little

Company name	Connells Survey & Valuation Ltd
--------------	---------------------------------

Address	Cumbria House, 16-20 Hockliffe Street, Leighton Buzzard, Bedfordshire, LU7 1GN
Date of report	6th July 2023



Property Address					
Address Seller's Name Date of Inspection	Ardpeaton, Caledonian Crescent, Gleneagles, Auchterarder, Perth and Kinross, PH3 1NG AMG 3rd July 2023				
Property Details					
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)				
Property Style	X Detached Semi detached Mid terrace End terrace Back to back High rise block Low rise block Other (specify in General Remarks)				
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No ilitary, police?				
Flats/Maisonettes only	y Floor(s) on which located No. of floors in block Lift provided? Yes No. of units in block				
Approximate Year of 0	Construction 1920				
Tenure					
X Absolute Ownership	Leasehold Ground rent £ Unexpired years				
Accommodation					
Number of Rooms	4 Living room(s) 4 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 2 WC(s) 1 Other (Specify in General remarks)				
Gross Floor Area (exc	cluding garages and outbuildings) 237 m² (Internal) m² (External)				
Residential Element (greater than 40%) X Yes No				
Garage / Parking / (Outbuildings				
X Single garage Available on site?	□ Double garage □ Parking space □ No garage / garage space / parking space X Yes □ No				
Permanent outbuildings:					
Single detached gar	age				

Construction							
Walls	X Brick	Stone	Concrete	Timber frame	Other	(specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	Other	(specify in Gen	eral Remarks)
Special Risks							
Has the property s	uffered struct	ural movement	1?			X Yes	No
If Yes, is this recer	nt or progress	ive?				Yes	X No
Is there evidence, immediate vicinity?		ason to anticipa	ate subsidence	, heave, landslip o	r flood in the	Yes	X No
If Yes to any of the	above, prov	ide details in G	eneral Remark	S.			
Service Connec	tion						
Based on visual in of the supply in Ge			s appear to be	non-mains, please	e comment or	n the type ar	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	Mains	Private	X None
Central Heating	X Yes	Partial	None				
Oil fired central h							
Site							
Apparent legal issu	ues to be veri	fied by the con	veyancer. Plea	se provide a brief	description ir	n General Re	emarks.
Rights of way	Shared driv	es / access	Garage or other	amenities on separate	site Share	ed service conn	ections
Ill-defined boundarie	es	Agricultura	al land included wit	th property	Other	(specify in Ge	neral Remarks)
Location							
X Residential suburb	Res	idential within towr	n / city Mixe	d residential / commerc	cial Mainl	y commercial	
Commuter village	Rer	note village	Isola	ted rural property	Other	(specify in Ge	neral Remarks)
Planning Issues							
Has the property b	een extended	d / converted / a	altered?	res X No			
If Yes provide deta	ils in Genera	l Remarks.					
Roads							
Made up road	Unmade road	d Partly co	mpleted new road	Pedestrian ad	ccess only	X Adopted	Unadopted

General Remarks
The property is in poor condition and extensive works are required internally and externally. This has been reflected in the valuation figure.
There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.
It is recommended that a reputable timber/damp specialist firm be employed to carry out a detailed inspection of the entire subjects and thereafter implement all necessary remedial works under cover of long term guarantee.
It is recommended that a reputable roofing contractor is employed to inspect the roof including roof/eaves spaces and provide a report on the condition/repairing costs prior to purchase.
The Valuation below is made on the assumption that full certification has been obtained in respect of any alterations which may have been carried out to the property. We are not aware of any alterations.
Other - Utility Room
Essential Repairs
The property is in poor condition and repairs have been reflected in the valuation figure.
Estimated cost of essential repairs £ Retention recommended? Yes X No Amount £

Comment on Mortgagea	bility	
The property generally protection the chosen mortgage prov	ovides adequate security for lending purposes subject to the individual lenvider.	nding criteria of
Valuations		
Buy To Let Cases What is the reasonable rangmonth Short Assured Tenang	n of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT) r? ge of monthly rental income for the property assuming a letting on a 6	£ 1100000 £
Signed Surveyor's name Professional qualifications Company name Address Telephone Fax Report date	Security Print Code [406592 = 6351] Electronically signed by:- A Little MA (HONS) MRICS Connells Survey & Valuation Ltd Cumbria House, 16-20 Hockliffe Street, Leighton Buzzard, Bedfordshire 01525 218647 01525 218632 6th July 2023	, LU7 1GN