# **HOME REPORT**

118 MORAR PLACE CASTLEPARK IRVINE KA12 9PX



# ENERGY PERFORMANCE CERTIFICATE



# **Energy Performance Certificate (EPC)**

Dwellings

# **Scotland**

# 118 MORAR PLACE, CASTLEPARK, IRVINE, KA12 9PX

Dwelling type: Mid-terrace house
Date of assessment: 29 September 2025
Date of certificate: 30 September 2025

**Total floor area:** 94 m<sup>2</sup>

Primary Energy Indicator: 180 kWh/m²/year

**Reference number:** 0100-2221-8010-2825-3735 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,501	See your recommendations
Over 3 years you could save*	£192	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

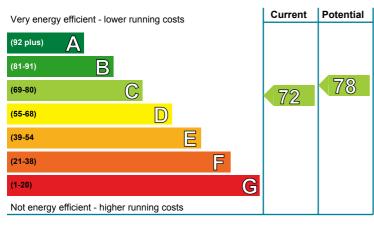


# **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

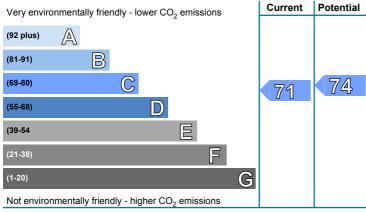

# **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is band C (71)

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

# Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£5,000 - £10,000	£192.00
2 Solar photovoltaic (PV) panels	£8,000 - £10,000	£660.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

# Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, as built, no insulation (assumed)	****	****
Roof	Pitched, 300 mm loft insulation	****	****
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	***	<b>★★★☆☆</b>
Main heating	Boiler and radiators, mains gas	****	<b>★★★★</b> ☆
Main heating controls	Programmer, room thermostat and TRVs	****	<b>★★★★</b> ☆
Secondary heating	None	_	_
Hot water	From main system	****	<b>★★★★</b> ☆
Lighting	Good lighting efficiency	***☆	<b>★★★★</b> ☆

# The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

# The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 33 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

# Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,727 over 3 years	£2,535 over 3 years	
Hot water	£525 over 3 years	£525 over 3 years	You could
Lighting	£249 over 3 years	£249 over 3 years	save £192
Totals	£3,501	£3,309	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

# Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Da	commanded massives	Indicative cost Typical saving Rating after impro		mprovement	
Re	commended measures	Indicative cost	per year	Energy	Environment
1	Floor insulation (suspended floor)	£5,000 - £10,000	£64	C 73	C 73
2	Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£220	C 78	C 74

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

Cavity, internal or external wall insulation

# Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

# About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

# 1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

# 2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

# Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

# Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	10,254.24	N/A	N/A	N/A
Water heating (kWh per year)	2,352.82			

# Addendum

This dwelling is a system built property or some of its walls are of non-conventional construction and requires further investigation to establish the type of construction, the type of wall insulation best suited (cavity insulation or internal/external insulation) and the savings it might deliver. Please contact the Home Energy Scotland hotline on 0808 808 2282 to find out more.

# **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mrs. Claudia Balmforth

Assessor membership number: EES/030355

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 45 Bank Street

Irvine

KA12 0LL

Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

# Information about the Green Deal Plan relating to this property

A Green Deal Plan has paid to install energy efficiency improvements at this property. If you become responsible for paying the electricity bill, you will be required to pay the Green Deal charge set out below. Also, you must comply with the terms and conditions in the Green Deal Plan. You should ask for a copy of the up to date Green Deal Plan from the owner of the property or the landlord and familiarise yourself with the contents.

# Energy Performance Certificate RRN: 0512-1007-8206-0425-8904

The Green Deal Plan can be paid off early, although charges may apply. The Green Deal Plan is an unsecured loan, which is regulated by the Consumer Credit Act 1974. It is designed to save you at least as much money as you will have to repay. However, the actual level of your savings will depend on how much energy you use (e.g. to heat your property) and the future cost of energy.

Current charge amount: £1.42 per day Payment period start: 05/08/2015 Payment period end: 25/07/2027 Interest rate payable: fixed at 8.3% APR

This is the current charge amount but there can be subsequent charging periods with different charge amounts depending on the detail of the Plan

### Plan charges:

- are payable as part of the electricity bill.
- reduce as each improvement is paid-off.

GD Plan number: AD0000274330

**Green Deal Provider:** Greenoke Energy Ltd

Tel: 01722 439 838

Email: greendeal@greenoke.co.uk

This EPC can only be used to disclose the Green Deal Plan until 30 Sep 2026. From 1 Oct 2026 a further

version should be retrieved from

www.scottishepcregister.org.uk using the EPC Report

Reference Number (RRN above)

### Improvements installed

### Paid-off in

Condensing gas boiler, flow temperature unknown

June 2027

Estimates of how these improvements could reduce annual energy bills for a typical user

Total: £1,436 p.a. Gas: £-598 p.a. Electricity: £2,034 p.a.

Other: £0 p.a.

Most improvements reduce the energy used for heating. These estimates are based on:

- the original Green Deal assessment;
- the improvements installed by this Plan (opposite);
- typical energy use for this type of property, using current energy prices.

If you are a low user of energy you may not achieve these estimated savings.

### Other important information

This Green Deal Plan is regulated by the Consumer Credit Act 1974. This provides certain protections to those paying the Plan instalments through their electricity bill.

The improvements listed above were installed under this Green Deal Plan and are due to be paid off at the times specified. If an improvement listed above has not been paid off, you should check that:

- it is still in place;
- no alterations have been made to this property that would reduce its effectiveness;
- it has been maintained in line with guidance from the Green Deal Provider.

If, after taking-on this property, you are considering or carrying out renovations that may impact on the improvements installed under this plan, or you notice that such changes have already been made, you must contact your Green Deal Provider.

Mandatory product guarantees are supplied for at least five years. These may be subject to maintenance or servicing requirements and you should check these have been met.

Charges may apply if you decide to repay this Green Deal Plan early and these details are set out in the Plan.

If you take on this property, you may have to repay this Plan early if you want to demolish this property or permanently disconnect the electricity supply – contact your Green Deal Provider for further details.

New bill payers are advised to contact their energy supplier when they take on a Green Deal property, particularly if the property has a pre-payment meter.

Further information can be found on the Green Deal Plan, a copy of which can be obtained from the owner of the property, or from the Green Deal Provider with the owner's consent.

# SINGLE SURVEY



# survey report on:

Property address	118 MORAR PLACE, CASTLEPARK, IRVINE, KA12 9PX
Customer	Siberite trading as Topaz
Customer address	
Prepared by	DM Hall LLP
Date of inspection	29th September 2025



# **PART 1 - GENERAL**

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

# 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
  or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

# 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

# 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

# 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

# 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

# 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

# PART 2 - DESCRIPTION OF THE REPORT

# 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

# 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

# 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

# 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

# 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

# 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

# 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

# 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property is a two storey mid-terrace house.	
Accommodation	Ground Floor: Entrance Hallway, Lounge, Kitchen.	
	First Floor: Landing, three Bedrooms, Bathroom.	
Gross internal floor area (m²)	Approximately 94 sq.m	
Neighbourhood and location	The property was built by the local authority and is located within an established residential area. Surrounding properties are of a similar age and character. Many appear to be in private ownership.	
	Local amenities are available within a reasonable distance.	
Age	Circa 50 years old.	
Weather	It was overcast and dry, following generally similar conditions.	
Chimney stacks	There are no chimney stacks.	
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.	
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.	
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.	
	The roof is pitched and tiled.	
	Access to the roof space is available via a hatch in the landing. The roof is of timber construction, with plywood. Insulation materials have been laid over and between the ceiling joists.	

Rainwater fittings	Visually inspected with the aid of binoculars where	
	appropriate.	
	The gutters are of a PVC, half round design with PVC, round downpipes.	
Main walls	Wissells in an actual with the sid of him and are where	
Mail Walls	Visually inspected with the aid of binoculars where appropriate.	
	Foundations and concealed parts were not exposed or inspected.	
	The outer walls appear to be a form of non-traditional construction commonly known as Wimpey No-Fines concrete. This is a type of solid concrete construction, lined internally and rendered externally with pointed facing brick finish to lower walls.	
	The damp proof course was not visible however, I would anticipate a building of this age to have a bitumen damp proof course or similar.	
	There is provision of sub floor ventilation via air vents at ground level.	
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.	
	Random windows were opened and closed where possible.	
	Doors and windows were not forced open.	
	The windows are of a double glazed UPVC type.	
	The access doors are of a UPVC double glazed design.	
	The fascias are formed in UPVC.	
External decorations	There are no outernal finishes that require describe	
External decorations	There are no external finishes that require decoration.	
External decorations  Conservatories / porches	There are no external finishes that require decoration.  There are no conservatories or porches.	
	· ·	
Conservatories / porches  Communal areas	There are no conservatories or porches.	
Conservatories / porches	There are no conservatories or porches.	
Conservatories / porches  Communal areas	There are no conservatories or porches.  There are no communal areas.	
Conservatories / porches  Communal areas  Garages and permanent outbuildings	There are no conservatories or porches.  There are no communal areas.  There are no garages or permanent outbuildings.	

Ceilings	Visually inspected from floor level.	
	The ceilings are formed in plasterboard.	
Internal walls	Visually inspected from floor level.	
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.	
	The walls are of timber stud construction with plasterboard finishes.	
	There are tile wall finishes.	
Floors including sub floors	The floors are of suspended timber construction.	
	No sub floor access was available.	
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.	
	Kitchen units were visually inspected excluding appliances.	
	The kitchen is fitted with a range of base and wall mounted units with laminate worktops.	
	The internal doors consist of a timber panel effect type. The door facings and skirting boards are of a timber or similar style.	
Chimney breasts and fireplaces	There are no chimney breasts/fireplaces.	
Internal decorations	Visually inspected.	
	The internal walls and ceilings have a papered and painted finish.	
Cellars	There are no cellars.	
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.  Mains supply installed.  The electricity consumer unit is located in the cupboard underneath	

Gas	Accessible parts of the system were visually inspected
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains gas supply installed.
	The gas meter is located in an external box.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks,
,, ,,	cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is connected to the mains supply.
	The bathroom is fitted with a white suite containing a WC, wash hand basin and bath with mixer shower.
	A stainless steel sink unit is fitted within the kitchen.
Heating and hot water	Accessible parts of the system were visually inspected apart
-	from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	There is a gas fired, Baxi central heating boiler located within the rear bedroom. This supplies a system of panel radiators throughout the property. The boiler also supplies the domestic howater.
	Drainage covers etc were not lifted.
_	Neither drains nor drainage systems were tested.
	Drainage appears to be connected to the main sewer.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.

# There are smoke detectors fitted within the property. Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

### Any additional limits to inspection

The property was vacant, partially furnished and all floors were covered. Consequently, my inspection of the flooring and other elements was restricted.

In accordance with Health and Safety Guidelines, I have not disturbed insulation or furniture and floor coverings have not been moved. Where present, personal effects within cupboards and wardrobes have not been moved, therefore limiting my inspection.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

My physical inspection of the roof void area was restricted due to insulation material, the limited size of the space and a lack of suitable crawl boards. As a result, the roof void area was only viewed from the access hatch.

My inspection of the roof covering was restricted from ground level and some parts were not visible.

I was unable to inspect the sub floor area as no suitable access hatch was available.

Services have been shut off or drained. Relevant trades should be on site when reintroducing services to identify and rectify all deficiencies.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

# Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
  - 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- (35) Foundations
- 36) Solum
- 7) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

# 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, rot and infestation	
Repair category	2
Notes	Elevated moisture readings were recorded to walls internally and further dampness may be present to other parts of the building. Prolonged dampness increases the risk of timber defects. It is important to remedy water ingress timeously to prevent deterioration of the building.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	No significant defects evident.  Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair or replacement costs.

Rainwater fittings	
Repair category	3
Notes	A section of downpipe is detached, this should be reinstated.  There is staining to the gutters/downpipes and these should be monitored for leaks.

Main walls	
Repair category	2
Notes	The render of outer walls is cracked and damaged. A building contractor can be asked to inspect and provide cost estimates for either repairing or replacing damaged areas.

Windows, external doors and joinery	
Repair category	2
Notes	The seals of double glazed units have failed, resulting in condensation between the panes of glass. These units can be repaired/replaced by a glazing contractor.  Some window units have broken ironmongery.
	Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional.

External decorations	
Repair category	-
Notes	Not applicable.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	2
Notes	Garden boundary fences display evidence of deterioration. A local builder can be asked to inspect and provide cost estimates for all required repair/rebuilding works.  Concrete surfaces are damaged and repairs are required.

Ceilings	
Repair category	2
Notes	There is plaster cracking to ceilings.

Internal walls	
Repair category	2
Notes	Cracked/damaged plaster finishes can be repaired prior to redecorating.

Floors including sub-floors	
Repair category	2
Notes	Sections of flooring are creaky and slope off level.
	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	2
Notes	There are missing kitchen unit doors, these should be reinstated.
	There is wear and tear to internal joinery finishes in places.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	2
Notes	Decorative finishes are worn and an incoming occupier can redecorate to their own personal taste.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electricity supply has been shut off. Services should be tested and reinstated by a qualified NICEIC/SELECT registered electrician.  It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	2
Notes	Gas services have been shut off. Services should be tested and reinstated by a Gas Safe registered contractor.  The gas meter box door is missing.

Gas	
Repair category	2
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

► Water, plumbing and bathroom fittings	
Repair category	2
Notes	Seals around the bath areas are defective. Failure to seals can result in dampness and decay within hidden areas of the property.  The bath panel is cracked and damaged.
	The water supply is currently turned off. Defects can appear when services are reintroduced. Reinstatement should be undertaken by a suitably qualified contractor.

Heating and hot water	
Repair category	2
Notes	The central heating system is shut down and drained. Services should be reinstated by a Gas Safe registered contractor.
	The central heating boiler is of an older type. Informed opinion suggests that many boilers have a life expectancy of between 10 and 20 years. A suitably qualified heating engineer will be able to advise further on repairing requirements or whether replacement is likely to be a more viable solution.
	It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.
	Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	3
Main walls	2
Windows, external doors and joinery	2
External decorations	-
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	-
Internal decorations	2
Cellars	-
Electricity	2
Gas	2
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

# Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

# Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

# Category 1

No immediate action or repair is needed.

# Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# 3. Accessibility information

# Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first.
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

# 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

# Matters for a solicitor or licensed conveyancer

Exact extent of garden grounds and location of boundaries can be confirmed by reference to the Title Deeds.

### Estimated reinstatement cost for insurance purposes

£230,000 (Two Hundred and Thirty Thousand Pounds)

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

# Valuation and market comments

£60,000 (Sixty Thousand Pounds)

Demand in line with the prevailing market conditions is anticipated.

It is assumed that the cost of repairing the Category 3 defect noted within the body of this report will have no material impact on the value of the property. However, we reserve the right to amend the valuation should further information/estimates become available.

Signed	Security Print Code [671752 = 8179 ] Electronically signed			
Report author	Claudia Balmforth			
Company name	DM Hall LLP			
Address	Eldo Hous, Monkton Road, Prestwick, Ayr, KA9 2PB			
Date of report	1st October 2025			



118 MORAR PLACE, CASTLEPARK, IRVINE, KA12 9PX Siberite trading as Topaz 29th September 2025
X House       Bungalow       Chalet       Purpose built maisonette         Coach       Studio       Converted maisonette       Purpose built flat         Converted flat       Tenement flat       Flat over non-residential use       Other (specify in General Remarks)
□ Detached       □ Semi detached       □ Mid terrace       □ End terrace         □ Back to back       □ High rise block       □ Low rise block       □ Other (specify in General Remarks)
lieve that the property was built for the public sector, X Yes No ilitary, police?
y Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block  Construction 1975
Leasehold Ground rent £ Unexpired years
1       Living room(s)       3       Bedroom(s)       1       Kitchen(s)         1       Bathroom(s)       0       WC(s)       0       Other (Specify in General remarks)
cluding garages and outbuildings) 94 m² (Internal) 108 m² (External)
greater than 40%) X Yes No
Outbuildings
□ Double garage       □ Parking space         □ Yes       □ No             X       No garage / garage space / parking space         □ Yes       □ No
gs:

Construction								
Walls	Brick	Stone		ncrete _	☐ Timber frame			
5 (	Solid	Cavity		eel frame	☐ Concrete block	C Othe	er (specify in Ger	neral Remarks)
Roof	X Tile	Slate		phalt	_ Felt			
	Lead	Zinc	Arti	ificial slate	Flat glass fibre	Othe	er (specify in Ger	neral Remarks)
Special Risks								
Has the property su	fered struct	tural moveme	ent?				X Yes	No
If Yes, is this recent	or progress	sive?					Yes	X No
Is there evidence, h immediate vicinity?	story, or rea	ason to antic	ipate subsi	dence, he	ave, landslip o	or flood in the	e Yes	X No
If Yes to any of the	above, prov	ide details in	General R	emarks.				
Ci C								
Service Connection								
Based on visual insport the supply in Gen			ces appear	to be non	-mains, pleas	e comment	on the type a	nd location
Drainage [	X Mains	Private	None		Water	X Mains	Private	None
Electricity	X Mains	Private	None		Gas	X Mains	Private	None
Central Heating [	X Yes	Partial	None					
Brief description of 0	Central Hea	ting:						
Gas fired boiler.								
Site								
Apparent legal issue	es to be veri	ified by the c	onvevance	r. Please i	provide a brief	f description	in General R	emarks.
Rights of way	Shared driv	-			nities on separate	_	red service con	
Agricultural land inclu				d boundaries			er (specify in Ge	
	•	•					· · ·	,
Location								
X Residential suburb	Res	sidential within to	own / city	Mixed res	sidential / comme	rcial Mai	nly commercial	
Commuter village	Rer	note village	Į	Isolated r	rural property	Oth	er (specify in Ge	eneral Remarks)
Planning Issues								
Has the property be	en extende	d / converted	/ altered?	Yes	X No			
If Yes provide detail	s in Genera	l Remarks.						
Roads								

General Remarks
Some items of repair and maintenance are required.
The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.
Essential Repairs
A section of downpipe is detached, this should be reinstated.
Estimated cost of essential repairs £ Neglig. Retention recommended? Yes X No Amount £ Incl.

Comment on Mortgagea	bility	
	suitable mortgage lending security at the valuation figure stated in this reparticularly on non-traditional construction.	port subject to
Valuations		
Buy To Let Cases  What is the reasonable rangmonth Short Assured Tenan	of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT) ? ge of monthly rental income for the property assuming a letting on a 6	£ 60,000 £ 60,000  £ 230,000  Yes X No
Declaration		
Signed Surveyor's name Professional qualifications Company name Address Telephone Fax	Security Print Code [671752 = 8179 ] Electronically signed by:- Claudia Balmforth BSc (Hons) MRICS DM Hall LLP Eldo Hous, Monkton Road, Prestwick, Ayr, KA9 2PB 01292 286974	
Report date	1st October 2025	

# PROPERTY QUESTIONNAIRE





Property address	118 MORAR PLACE, CASTLEPARK, IRVINE, KA12 9PX
Seller(s)	Siberite
Completion date of property questionnaire	25/09/25

# **Note for sellers**

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

# Information to be given to prospective buyer(s)

1.	Length of ownership						
••	Length of ownership						
	How long have you owned the prop	erty?	Can	not ans	swer*		
2.	Council tax						
	Which Council Tax band is your pro	perty in	? (Pleas	se circle	<del>)</del> )		
	A B C D	E	F	G	Н	Cannot answe	er*
3.	Parking						
	What are the arrangements for park	ing at yo	our prop	erty?			
	(Please tick all that apply)						
	Garage						
	Allocated parking space						
	<ul><li>Driveway</li></ul>						
	Shared parking						
	On street						
	Resident permit						
	Metered parking						
	Other (please specify):						
		Canno	ot answ	er*			
4.	Conservation area						
	Is your property in a designated architectural or historical interest, desirable to preserve or enhance)?	Conserv the cha	ration A	area (i.e or appe	e. an ar earance	ea of special of which it is	Yes / No / Den't knew Cannot answer*

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No Cannot answer*
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered yes, please describe below the changes which you have made:	Yes / No Cannot answer*
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes / Ne
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?  If you have answered yes, please answer the three questions below:	Yes / No Cannot answer*
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / Ne
	(ii) Did this work involve any changes to the window or door openings?	Yos / No
	(iii) Please describe the changes made to the windows, doors or patio doors (vidates when the work was completed):	with approximate
	Please give any guarantees which you received for this work to your solicitor or e	estate agent.

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / No / Partial Cannot answer*
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	
C.	Do you have a maintenance contract for the central heating system?	Yes / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No Cannot answer*
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes / No Cannot answer*
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<del>Yes</del> / <del>Ne</del>
b.	Are you aware of the existence of asbestos in your property?	Yes / No Cannot answer*
	If you have answered yes, please give details:	Carriot answer

10.	Services		and since details				
a.	Please tick which services are connected to your property and give details of supplier:						
	Services	Connected	Supplier				
	Gas / liquid petroleum gas	Cannot answer*					
	Water mains / private water supply	Cannot answer*					
	Electricity	Cannot answer*					
	Mains drainage	Cannot answer*					
	Telephone	Cannot answer*					
	Cable TV / satellite	Cannot answer*					
	Broadband	Cannot answer*					
b.	Is there a septic tank system at you have answered yes, please		estions below:	Yes / No Cannot answer*			
C.	(i) Do you have appropriate consents for the discharge from your septic tank?						
d.	d. (ii) Do you have a maintenance contract for your septic tank?						
	If you have answered yes, please have a maintenance contract:	e give details of th	ne company with which you				

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes / No / Don't Know Cannot answer*
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Yes / No / Not applicable Cannot answer*
	If you have answered yes, please give details:	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes / No Cannot answer*
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes / No Cannot answer*
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes / No Cannot answer*
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yes / No Cannot answer*
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yos / No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	Cannot answer*

b.	Is there a common buildings insurance policy?	Yes / No / Don't Know Cannot answer*
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	<del>Yes</del> / <del>Ne</del> / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / No Cannot answer*
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes / No Cannot answer*
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	Ne	Yes	Don't know	With title doods	Lost	Cannot Answer*
(iii)	Central heating	No	Yos	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(v)	Damp course	Ne	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	Ne	Yes	Don't know	With title deeds	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):						
c.	Are there any outstanding claims under any of the guarantees listed above?  If you have answered yes, please give details:					Yes / No	
15.	Boundaries						
	So far as you are aware, has any boundary of your property been moved in the last 10 years?  If you have answered yes, please give details:				Yes / No / Don't know Cannot answer*		

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yos / No / Don't know Cannot answer*
b.	that affects your property in some other way?	Yos / No / Don't know Cannot answer*
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Don't know Cannot answer*
	If you have answered yes to any of a-c above, please give the notices to your sagent, including any notices which arrive at any time before the date of entry of your property.	olicitor or estate the purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
_			
Date:			

<sup>\*</sup> This report has been completed on behalf of the lender in respect to a repossessed property and therefore some information is not available.



# **ABERDEEN**

aberdeen\_residential@dmhall.co.uk01224 594172

# **AYR**

ayr@dmhall.co.uk 01292 286974

# **DUMFRIES**

dumfries@dmhall.co.uk 01387 254318

# **DUNDEE**

dundee@dmhall.co.uk 01382 873100

# **DUNFERMLINE**

dunfermline@dmhall.co.uk 01383 621262

# **EDINBURGH**

edinburghresidential@dmhall.co.uk 0131 624 6600

### **FLGIN**

elgin@dmhall.co.uk 01343 548501

# **FALKIRK**

falkirk@dmhall.co.uk 01324 628321

# **GALASHIELS**

galashiels@dmhall.co.uk 01896 752009

# **GLASGOW** (Residential)

glasgowresidential@dmhall.co.uk0141 636 4141

# **HAMILTON**

hamilton@dmhall.co.uk 01698 284939

# **INVERNESS**

inverness@dmhall.co.uk 01463 241077

# **INVERURIE**

inverurie@dmhall.co.uk 01467 624393

# **IRVINE**

irvine@dmhall.co.uk 01294 311070

# **KIRKCALDY**

kirkcaldy@dmhall.co.uk 01592 598200

# LIVINGSTON

livingston@dmhall.co.uk 01506 490404

# **OBAN**

oban-admin@dmhall. co.uk 01631 564225

# **PAISLEY**

Enquiries are now dealt with at our Glasgow Hub.

# **PERTH**

perth@dmhall.co.uk 01738 562100

# **PETERHEAD**

peterhead@dmhall.co.uk 01779 470220

# **ST ANDREWS**

standrews@dmhall.co.uk 01334 844826

# **STIRLING**

stirling@dmhall.co.uk 01786 475785

