# **HOME REPORT**

#### 1 CRAIG AVENUE DALRY KA24 5EN



# ENERGY PERFORMANCE CERTIFICATE



## **Energy Performance Certificate (EPC)**

Dwellings

# **Scotland**

#### 1 CRAIG AVENUE, DALRY, KA24 5EN

Dwelling type:Semi-detached houseDate of assessment:20 September 2023Date of certificate:20 September 2023

**Total floor area:** 90 m<sup>2</sup>

Primary Energy Indicator: 314 kWh/m²/year

**Reference number:** 2308-1017-2201-9167-8204 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

**Main heating and fuel:** Boiler and radiators, mains


gas

#### You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,617	See your recommendations
Over 3 years you could save*	£1,245	report for more information

<sup>\*</sup> based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

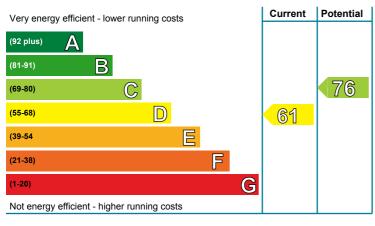


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

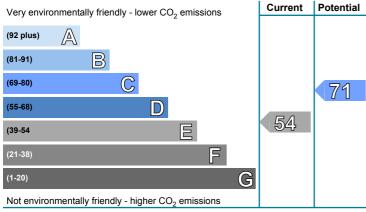

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (54)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£800 - £1,200	£456.00
2 Low energy lighting	£20	£162.00
3 Heating controls (TRVs)	£350 - £450	£258.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, as built, no insulation (assumed)	****	****
Roof	Pitched, 250 mm loft insulation	****	<b>★★★★</b> ☆
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, mains gas	****	<b>★★★★</b> ☆
Main heating controls	Programmer and room thermostat	<b>★★★☆☆</b>	<b>★★★☆☆</b>
Secondary heating	None	_	_
Hot water	From main system	***	<b>★★★★</b> ☆
Lighting	Low energy lighting in 56% of fixed outlets	****	****

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 55 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,997 over 3 years	£5,346 over 3 years	
Hot water	£1,017 over 3 years	£609 over 3 years	You could
Lighting	£603 over 3 years	£417 over 3 years	save £1,245
Tota	als £7,617	£6,372	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Recommended measures		Indicative cost	Typical saving	Rating after improvement	
		Indicative cost	per year	Energy	Environment
1	Floor insulation (suspended floor)	£800 - £1,200	£152	D 63	D 56
2	Low energy lighting for all fixed outlets	£20	£54	D 63	D 57
3	Upgrade heating controls	£350 - £450	£86	D 65	D 59
4	Solar water heating	£4,000 - £6,000	£123	D 67	D 62
5	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£638	C 76	C 71

#### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

Cavity, internal or external wall insulation

#### Choosing the right improvement package





#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

#### 2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

#### 3 Heating controls (thermostatic radiator valves)

Thermostatic radiator valves allow the temperature of each room to be controlled to suit individual needs, adding to comfort and reducing heating bills provided internal doors are kept closed. For example, they can be set to be warmer in the living room and bathroom than in the bedrooms. Ask a competent heating engineer to install thermostatic radiator valves. Thermostatic radiator valves should be fitted to every radiator except the radiator in the same room as the room thermostat. Remember the room thermostat is needed as well as the thermostatic radiator valves, to enable the boiler to switch off when no heat is required. Building regulations generally apply to this work, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

#### 4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### 5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	16,274	N/A	N/A	N/A
Water heating (kWh per year)	2,868			

#### **Addendum**

This dwelling is a system built property or some of its walls are of non-conventional construction and requires further investigation to establish the type of construction, the type of wall insulation best suited (cavity insulation or internal/external insulation) and the savings it might deliver. Please contact the Home Energy Scotland hotline on 0808 808 2282 to find out more.

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Greg Fisher
Assessor membership number: EES/017520

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 45 Bank Street

Irvine KA12 0LL

Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



# SINGLE SURVEY



## survey report on:

Property address	1 CRAIG AVENUE DALRY KA24 5EN
Customer	Derek Skinner
Customer address	
Prepared by	DM Hall LLP
Date of inspection	20th September 2023



#### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report <sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

#### WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A semi detached two storey villa.
Accommodation	On Ground Floor:
	Entrance Hall, Lounge, Kitchen, Shower Room.
	On First Floor:
	Landing, 3 Bedrooms.
Gross internal floor area (m²)	89sqm approx.
Neighbourhood and location	The property was built by the Local Authority and is located within an established residential area where surrounding properties are of a similar age and character. Many appear to be in private ownership.  Local amenities are readily available within Dalry town centre.
Age	Approximately 70 years.
Weather	Overcast but dry. Weather over recent weeks has been settled.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	Brick construction with a rendered finish. Adjacent flashings appear to be formed in lead.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.  Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.	
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.	
	The roof is pitched and covered in tiles.	
	I was able to inspect the roof space and gained access from a hatch within the first floor landing.	
	The roof is built of timber trusses and boarded over with timber sarking board material.	
	Insulation material is laid between and over the ceiling joists.	
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.	
	Rainwater units are of cast iron and PVC material consisting of half round gutters feeding round downpipes.	
Main walls	Visually inspected with the aid of binoculars where appropriate.	
	Foundations and concealed parts were not exposed or inspected.	
	The outer walls are of non-traditional construction, the specific type known as 'Swedish' timber. This is a form of timber framed construction, clad externally in timber and lined internally.	
	Lower walls appear to be of masonry construction with an external finish of rendered. There are sub-floor ventilators to lower walls.	
	The damp proof course was not visible, however, I would anticipate a building of this age to have a bitumen damp proof course or similar.	
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.	
	Random windows were opened and closed where possible.	
	Doors and windows were not forced open.	
	Windows and external doors are of UPVC double glazed type.	
	There are timber fascia and soffit boards.	

External decorations	Visually inspected.
External decorations	
	External decorative finishes are painted where appropriate.
Conservatories / porches	None
Constitution persons	NO.IC
Communal areas	None
Garages and permanent outbuildings	None
Outside areas and boundaries	Visually inspected.
	There are garden grounds to the front, side and rear of the property, these are laid generally to grass, concrete paving and bedding.
	Boundary divisions are marked by timber fencing, hedges and metal fences.
	There is a paved driveway to the side of the property.
Ceilings	Visually inspected from floor level.
	Ceilings appear to be of plasterboard material.
	There are some textured plaster finishes.
	VC
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are of timber and plasterboard stud construction with a decorated finish.
	There are some tiled wall finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Flooring is of suspended timber construction.
	I was unable to inspect the sub-floor area as there was no suitable access hatch available.

Internal joinery and kitchen fittings  Built-in cupboards were looked into but n moved.	
	o stored items were
Kitchen units were visually inspected exc	luding appliances.
Internal joinery is of timber and there are timb	ber internal doors.
The kitchen contains a range of floor and wa units and worktops.	ll mounted storage
Chimney breasts and fireplaces Visually inspected.	
No testing of the flues or fittings was carr	ied out.
There is an electric fire, housed within a timb lounge.	er fireplace in the
Internal decorations Visually inspected.	
Internal decorative finishes are papered or pa	ainted.
Cellars None	
Electricity  Accessible parts of the wiring were visual removing fittings. No tests whatsoever w system or appliances. Visual inspection of services to make sure they work properly	ere carried out to the does not assess any and efficiently and
meet modern standards. If any services a surveyor will state that in the report and with Mains supply. The electrical switch gear is I cupboard in the hallway.	vill not turn them on.
Mains supply. The electrical switch gear is I	ally inspected without ere carried out to the does not assess any and efficiently and are turned off, the
Gas  Accessible parts of the system were visual removing fittings. No tests whatsoever will system or appliances. Visual inspection of services to make sure they work properly meet modern standards. If any services a surveyor will state that in the report and will make supply.	ally inspected without rere carried out to the does not assess any and efficiently and are turned off, the will not turn them on.
Gas  Accessible parts of the system were visual removing fittings. No tests whatsoever we system or appliances. Visual inspection of services to make sure they work properly meet modern standards. If any services a surveyor will state that in the report and visual inspection of services and surveyor will state that in the report and visual inspection of services and surveyor will state that in the report and visual inspection of services and surveyor will state that in the report and visual inspection of services and surveyor will state that in the report and visual inspection of services and surveyor will state that in the report and visual inspection of services and surveyor will state that in the report and visual inspection of services and surveyor will state that in the report and visual inspection of services and services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the report and visual inspection of services are surveyor will state that in the services are surveyor will servey or services are surveyor will servey or services are surve	ally inspected without there carried out to the does not assess any and efficiently and are turned off, the will not turn them on.
Gas  Accessible parts of the system were visual removing fittings. No tests whatsoever we system or appliances. Visual inspection of services to make sure they work properly meet modern standards. If any services a surveyor will state that in the report and we Mains supply.  Water, plumbing, bathroom fittings  Visual inspection of the accessible pipew	ally inspected without ere carried out to the does not assess any and efficiently and are turned off, the will not turn them on.
Surveyor will state that in the report and we mains supply. The electrical switch gear is lead to cupboard in the hallway.  Accessible parts of the system were visual removing fittings. No tests whatsoever we system or appliances. Visual inspection of services to make sure they work properly meet modern standards. If any services a surveyor will state that in the report and we main supply.  Water, plumbing, bathroom fittings  Visual inspection of the accessible pipewer cylinders and fittings without removing and No tests whatsoever were carried out to the	ally inspected without ere carried out to the does not assess any and efficiently and are turned off, the will not turn them on.
Surveyor will state that in the report and we mains supply. The electrical switch gear is I cupboard in the hallway.  Accessible parts of the system were visual removing fittings. No tests whatsoever we system or appliances. Visual inspection of services to make sure they work properly meet modern standards. If any services a surveyor will state that in the report and we mains supply.  Water, plumbing, bathroom fittings  Visual inspection of the accessible pipewer cylinders and fittings without removing at No tests whatsoever were carried out to the appliances.	ally inspected without there carried out to the does not assess any and efficiently and are turned off, the will not turn them on.  ork, water tanks, ny insulation.  the system or

#### Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

There is an 'Ideal' wall mounted gas fired central heating boiler located within a cupboard in the first floor landing. This serves water filled radiators throughout the property and also provides domestic hot water.

The hot water storage tank is located within the same cupboard in the landing.

#### Drainage

Drainage covers etc. were not lifted.

Neither drains nor drainage systems were tested.

Drainage is to the main public sewerage system.

#### Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

There are smoke alarms within the property. Smoke alarms are untested and I am unable to confirm if these are interlinked to comply with recently introduced legislation. Purchasers should satisfy themselves in this regard.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

#### Any additional limits to inspection

The property was unoccupied, unfurnished although all floors were covered. Fitted floor coverings restricted my inspection of flooring surfaces.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a licensed specialist.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

My physical inspection of the roof void area was restricted due to insulation material, stored items and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.

I was not able to inspect the sub floor area.

Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

#### Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- Coping stone
- Chimney head
- Flashing
- Ridge ventilation
- Ridge board
- Slates / tiles
- Valley guttering
- **Dormer projection**
- **Dormer flashing**
- **Dormer cheeks**
- Sarking
- Roof felt
- Trusses
- Collar
- Insulation
- Parapet gutter
- **Eaves guttering**
- Rainwater downpipe
- Verge boards /skews
- Soffit boards
- Partition wall
- Lath / plaster
- Chimney breast
- Window pointing
- Window sills
- Rendering
- Brickwork / pointing
- Bay window projection
- Lintels
- Cavity walls / wall ties
- Subfloor ventilator
- Damp proof course
- Base course
- **Foundations**
- Solum
- Floor joists
- Floorboards
- Water tank
- Hot water tank

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation

Chimney stacks	
Repair category	1
Notes	No significant defects noted from ground level, however, chimney stacks are frequently troublesome and often the source of water ingress/dampness. On-going monitoring and maintenance can be anticipated. It may be prudent to have the chimney stack inspected prior to purchase. Inspection at close quarters may reveal defects not visible from ground level.

Roofing including roof space	
Repair category	1
Notes	I am advised by the Seller, the roof covering was replaced approximately 1 year ago and remains under manufacturers warranty. It should be confirmed if this warranty is transferable in favour of new owners.  Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.

Rainwater fittings	
Repair category	1
Notes	No significant defects evident.

Main walls	
Repair category	1
Notes	External walls are of non traditional construction, being clad externally in timber.  Construction of this type requires ongoing monitoring and maintenance.

Windows, external doors and joinery	
Repair category	2
Notes	Windows are of a style consistent with having been installed a number of years ago. General age related wear and tear is noted to window units and mechanisms.  At the time of inspection, the front door was locked with no key available. Purchasers should satisfy themselves as to its operation.

External decorations	
Repair category	2
Notes	External decorative finishes are weathered and require repainting.

Conservatories/porches	
Repair category	-
Notes	None

Communal areas	
Repair category	-
Notes	None

Garages and permanent outbuildings	
Repair category	-
Notes	None

Outside areas and boundaries	
Repair category	1
Notes	Garden grounds are generally well maintained.

Ceilings	
Repair category	1
Notes	The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	No significant defects evident.  It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	1
Notes	General age related wear and tear is noted to joinery finishes are kitchen units.

Chimney breasts and fireplaces	
Repair category	1
Notes	No significant defects evident.

Internal decorations	
Repair category	1
Notes	Adequately presented throughout.

Cellars	
Repair category	-
Notes	None

Electricity	
Repair category	2
Notes	The electrical installation is dated as the electrical switch gear is of a style consistent with having been installed a number of years ago and there are a lack of electrical sockets in some apartments. Further advice will be available from a NICEIC/SELECT registered electrician.  It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing and bathroom fittings				
Repair category	1			
Notes	No significant defects evident.			

Heating and hot water				
Repair category	2			
Notes	The central heating boiler was installed circa 2006.			
	Informed opinion suggests that boilers have a life expectancy between 10 and 20 years depending on the quality of the boiler and whether or not regular maintenance has been carried out. Future repair or replacement should be anticipated.			
	I am advised by the Seller, a maintenance contract is in place for the central heating system which incorporates an annual service. Industry best practice directive suggests this should continue on an annual basis.			

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

#### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground	
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No	
3. Is there a lift to the main entrance door of the property?	Yes No X	
4. Are all door openings greater than 750mm?	Yes No X	
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No	
6. Is there a toilet on the same level as a bedroom?	Yes No X	
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X	
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No	

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

No significant issues based upon the limitations of my inspection.

#### Estimated reinstatement cost for insurance purposes

£180,000 (One Hundred and Eighty Thousand Pounds)

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

#### Valuation and market comments

£65,000 (Sixty Five Thousand Pounds)

The reported valuation is a snapshot in time and reflects the prevailing market conditions Against a backdrop of changing economic circumstances and increasing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

Signed	Security Print Code [270711 = 6425 ] Electronically signed
Report author	Greg Fisher
Company name	DM Hall LLP
Address	45 Bank Street, Irvine, Ayrshire, KA12 0LL
Date of report	25th September 2023

# Mortgage Valuation Report



Property Address					
Address Seller's Name Date of Inspection	1 CRAIG AVENUE, DALRY, KA24 5EN Derek Skinner 20th September 2023				
Property Details					
Property Type	X House       Bungalow       Purpose built maisonette       Converted maisonette         Purpose built flat       Converted flat       Tenement flat       Flat over non-residential use         Other (specify in General Remarks)				
Property Style	□ Detached       X Semi detached       □ Mid terrace       □ End terrace         □ Back to back       □ High rise block       □ Low rise block       □ Other (specify in General Remarks)				
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, X Yes No illitary, police?				
Flats/Maisonettes only Approximate Year of 0	No. of units in block				
Tenure					
X Absolute Ownership	Leasehold Ground rent £ Unexpired years				
Accommodation					
Number of Rooms	1 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)				
Gross Floor Area (excluding garages and outbuildings)  89 m² (Internal)  97 m² (External)  Residential Element (greater than 40%) X Yes No					
Garage / Parking / 0	Outbuildings				
Single garage Available on site?  Permanent outbuilding	☐ Double garage ☐ No garage / garage space / parking space ☐ No garage / garage space / parking space ☐ Space ☐ No garage / garage space / parking space ☐ No garage / g				
None noted.					

# Mortgage Valuation Report

Construction								
Walls	Brick	Stone	Concret	e X Timber frame	Othe	Other (specify in General Remarks)		
Roof	X Tile	Slate	Asphalt	Felt	Othe	er (specify in Gen	eral Remarks)	
Special Risks								
Has the property	suffered struc	tural movem	ent?			Yes	X No	
If Yes, is this rece	ent or progress	sive?				Yes	No	
Is there evidence, immediate vicinity	•	ason to antic	ipate subsiden	ce, heave, landslip	or flood in th	e Yes	X No	
If Yes to any of th	e above, prov	ide details in	General Rema	ırks.				
Service Connec	ctions							
Based on visual ir of the supply in G			ices appear to	be non-mains, plea	se comment	on the type a	nd location	
Drainage	X Mains	Private	None	Water	X Mains	Private	None	
Electricity	X Mains	Private	None	Gas	X Mains	Private	None	
Central Heating	X Yes	Partial	None					
Brief description of	of Central Hea	ting:						
Gas fired system	of radiators.							
Site								
Apparent legal iss	sues to be ver	ified by the c	onveyancer. P	lease provide a brid	ef description	n in General R	temarks.	
Rights of way		res / access		er amenities on separat		ared service conn		
Ill-defined boundar	ries	Agricu	tural land included	with property	Oth	er (specify in Ge	neral Remarks)	
Location								
Residential suburb	X Res	sidential within to	own / city	ixed residential / commo	ercial Mai	inly commercial		
Commuter village	Rer	mote village	Is	olated rural property	Oth	er (specify in Ge	neral Remarks)	
Planning Issues	s							
Has the property been extended / converted / altered? Yes X No  If Yes provide details in General Remarks.								
	ans in Genera	ıı ıveilidikə.						
Roads								
X Made up road	Unmade roa	d Partly	completed new ro	ad Pedestrian	access only	Adopted	Unadopted	

### Mortgage Valuation Report

General Remarks
Generally, the subjects were found to be in a condition commensurate with age and style of construction. No obvious significant defects which would affect value or suitability for mortgage lending purpose were in evidence.
The property is of non traditional construction, the specific type known as 'Swedish' timber. This is a form of timber framed property, clad externally in timber and lined internally.
Essential Repairs
None apparent.
Estimated cost of essential repairs £ Retention recommended? Yes _X No _ Amount £

### Mortgage Valuation Report

Comment on Mortgageability			
The subjects form suitable lender criteria on non tradi	e mortgage security at the valuation figure stated below, subject to individitional construction.	ual mortgage	
Valuations			
Market value in present con Market value on completion Insurance reinstatement va (to include the cost of total it Is a reinspection necessary	of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 65,000 £ 180,000	
Buy To Let Cases			
What is the reasonable rangmonth Short Assured Tenair	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£	
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No	
Declaration			
Signed Surveyor's name	Security Print Code [270711 = 6425 ] Electronically signed by:- Greg Fisher		
Professional qualifications	BSc (Hons) MSc MRICS		
Company name	DM Hall LLP		
Address	45 Bank Street, Irvine, Ayrshire, KA12 0LL		
Telephone	01294 311070		
Fax			

25th September 2023

Report date

# PROPERTY QUESTIONNAIRE





Property address	1 Craig Avenue
	Dalry
	KA24 5EN
Seller(s)	Mrs Elizabeth Skinner
Completion date of property	25/9/2023

#### **Note for sellers**

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

#### Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 32 years	
2.	Council tax	
	Which Council Tax band is your property in? (Please tick one)	
	⊠A □B □C □D □E □F □G □H	
3.	Parking	
	What are the arrangements for parking at your property?	
	(Please tick all that apply)	
	• Garage	
	Allocated parking space	
	• Driveway 🖂	
	Shared parking	
	• On street ⊠	
	Resident permit	
	Metered parking	
	Other (please specify):	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of	☐ Yes
	special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	⊠ No
		☐ Don't know

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☑ No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered yes, please describe below the changes which you have made:	☐ Yes ⊠ No
	<ul><li>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</li><li>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</li><li>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</li></ul>	☐ Yes ☐ No
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?  If you have answered yes, please answer the three questions below:	⊠ Yes □ No
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes ☑ No
	(iii) Please describe the changes made to the windows doors, or patio approximate dates when the work was completed):	doors (with
	Please give any guarantees which you received for this work to your so agent.	olicitor or estate

7.	Central heating	
a.	Is there a central heating system in your property?	⊠ Yes
	(Note: a partial central heating system is one which does not heat all the main rooms of the property $\boldsymbol{-}$	□ No
	the main living room, the bedroom(s), the hall and the bathroom).	☐ Partial
	$\underline{\text{If you have answered yes or partial}}$ – what kind of central heating is there?	
	(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	gas	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating	g system installed?
	2006	
	(ii) Do you have a maintenance contract for the central heating system?	⊠ Yes
	If you have answered yes, please give details of the company with which you have a maintenance contract:	□No
	which you have a maintenance contract.	
	(iii) When was your maintenance agreement last renewed? (Please and year).	provide the month
	feb 2023	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is	⊠ Yes
	less than 10 years old?	□ No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	☐ Yes
	your property write you have owned it:	⊠ No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes
	oacocanamy mourance claim.	□ No
b.	Are you aware of the existence of asbestos in your property?	☐ Yes

If you have answered yes, please give details:	⊠ No

10.	Services	
<b>a.</b> Plo	ease tick which services are connected to your property and give details	of the supplier:
Servi	ces	
Conn	ected	
Supp	lier	
Gas o	r liquid petroleum gas	
britis	sh gas	
Water	mains or private water supply	
scott	ish water	
Electr	icity	
scott	ish gas	
Mains	drainage	
scott	ish water	
Telep	hone	
bt		
	TV or satellite	
n/a		
Broad	lband	

n/a		
b.	Is there a septic tank system at your property?	☐ Yes
	If you have answered yes, please answer the two questions below:	⊠ No
	(iv) Do you have appropriate consents for the discharge from your septic tank?	☐ Yes
	Septie tarik.	☐ No
		☐ Don't Know
	(v) Do you have a maintenance contract for your septic tank?	☐ Yes
	If you have answered yes, please give details of the company with which you have a maintenance contract:	□ No

11. Responsibi	ilities for shared or common areas	
anything used	re of any responsibility to contribute to the cost of d jointly, such as the repair of a shared drive, private ary, or garden area?	☐ Yes ☑ No
<u>If you have a</u>	nswered <u>yes</u> , please give details:	☐ Don't Know
the roof, com	sponsibility to contribute to repair and maintenance of amon stairwell or other common areas?  Inswered yes, please give details:	☐ Yes ☑ No ☐ Not applicable
	en any major repair or replacement of any part of the ne time you have owned the property?	⊠ Yes □ No
— for exampl boundaries?	the right to walk over any of your neighbours' property le to put out your rubbish bin or to maintain your inswered yes, please give details:	☐ Yes ☑ No
walk over you to maintain th	are aware, do any of your neighbours have the right to ur property, for example to put out their rubbish bin or heir boundaries?  Inswered yes, please give details:	☐ Yes ☑ No
part of your p public has a r owned.)	are aware, is there a public right of way across any property? (public right of way is a way over which the right to pass, whether or not the land is privately-  answered yes, please give details:	☐ Yes ⊠ No
12. Charges as	ssociated with your property	
a. Is there a fac	ctor or property manager for your property?	☐ Yes
	inswered yes, please provide the name and address, ails of any deposit held and approximate charges:	⊠ No

b.	Is there a common buildings insurance policy?	☐ Yes
		⊠ No
		☐ Don't Know
	If you have answered yes, is the cost of the insurance included in	☐ Yes
	your monthly/annual factor's charges?	□ No
		☐ Don't Know
C.	Please give details of any other charges you have to pay on a regular bupkeep of common areas or repair works, for example to a residents' a maintenance or stair fund.	
	n/a	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?  If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ☑ No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?  If you have answered yes, please give details:	☐ Yes ☑ No
ρ	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?  If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.  Guarantees are held by:	☐ Yes☐ No

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work					
(ii)	Roofing		$\boxtimes$			
(iii)	Central heating					
(iv)	National House Building Council (NHBC)					
(v)	Damp course					
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)					
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):  10 year guarantee for roof fitted in 2020					
C.	Are there any outstanding claims under any of the guarantees listed above?				☐ Yes	
	If you have answered yes, please give details:				⊠ No	
15.	Boundaries					
	So far as you are aware, has any boundary of your property been				☐ Yes	
	moved in the last 10 years?			⊠ No		
	If you have answered yes, please give details:				☐ Don't know	

16.	Notices that affect your property					
	In the past three years have you ever received a notice:					
a.	advising that the owner of a neighbouring property has made a planning application?	☐ Yes				
	planning application:	⊠ No				
b.	that affects your property in some other way?	☐ Yes				
		⊠ No				
c.	that requires you to do any maintenance, repairs or improvements to your property?	☐ Yes				
	to your property:	⊠ No				
		have answered yes to any of a-c above, please give the notices to your solicitor cagent, including any notices which arrive at any time before the date of entry of rchaser of your property.				
Declaration by the seller(s)/or other authorised body or person(s)  I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.						
Sign	ature(s):					
Date	<b>:</b>					



#### **ABERDEEN**

aberdeen\_residential@dmhall.co.uk01224 594172

#### **AYR**

ayr@dmhall.co.uk 01292 286974

#### **DUMFRIES**

dumfries@dmhall.co.uk 01387 254318

#### **DUNDEE**

dundee@dmhall.co.uk 01382 873100

#### **DUNFERMLINE**

dunfermline@dmhall.co.uk 01383 621262

#### **EDINBURGH**

edinburghresidential@dmhall.co.uk 0131 624 6600

#### **FLGIN**

elgin@dmhall.co.uk 01343 548501

#### **FALKIRK**

falkirk@dmhall.co.uk 01324 628321

#### **GALASHIELS**

galashiels@dmhall.co.uk 01896 752009

#### **GLASGOW** (Residential)

glasgowresidential@dmhall.co.uk 0141 636 4141

#### **HAMILTON**

hamilton@dmhall.co.uk 01698 284939

#### **INVERNESS**

inverness@dmhall.co.uk 01463 241077

#### **INVERURIE**

inverurie@dmhall.co.uk 01467 624393

#### **IRVINE**

irvine@dmhall.co.uk 01294 311070

#### **KIRKCALDY**

kirkcaldy@dmhall.co.uk 01592 598200

#### LIVINGSTON

livingston@dmhall.co.uk 01506 490404

#### **OBAN**

oban-admin@dmhall. co.uk 01631 564225

#### **PAISLEY**

Enquiries are now dealt with at our Glasgow Hub.

#### **PERTH**

perth@dmhall.co.uk 01738 562100

#### **PETERHEAD**

peterhead@dmhall.co.uk 01779 470220

#### **ST ANDREWS**

standrews@dmhall.co.uk 01334 844826

#### **STIRLING**

stirling@dmhall.co.uk 01786 475785

