

60 GLEN NEVIS DRIVE DUNFERMLINE KY11 4QT



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

60 GLEN NEVIS DRIVE, DUNFERMLINE, KY11 4QT

Dwelling type:Mid-terrace houseDate of assessment:29 August 2024Date of certificate:29 August 2024

Total floor area: 57 m²

Primary Energy Indicator: 226 kWh/m²/year

Reference number: 2713-1001-2208-2914-4200 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: ECMK

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,805	See your recommendations
Over 3 years you could save*	£861	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

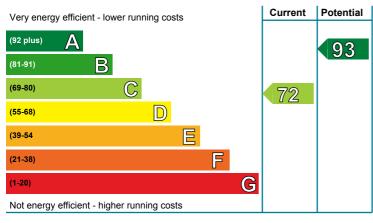


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

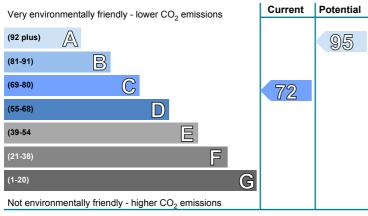

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (solid floor)	£4,000 - £6,000	£144.00
2 Heating controls (room thermostat and TRVs)	£350 - £450	£279.00
3 Solar water heating	£4,000 - £6,000	£159.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, 200 mm loft insulation	****	★★★★☆
Floor	Solid, no insulation (assumed)	_	_
Windows	Some double glazing	***	***
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, no room thermostat	***	****
Secondary heating	None	_	_
Hot water	From main system	****	★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 40 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

L-CE vv94.0.1.1 (SAP 9.94) Page 1 of 5

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,109 over 3 years	£1,407 over 3 years	
Hot water	£471 over 3 years	£312 over 3 years	You could
Lighting	£225 over 3 years	£225 over 3 years	save £861
Tota	ls £2,805	£1,944	over 3 years


These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December de division de		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	Indicative cost	per year	Energy	Environment
1	Floor insulation (solid floor)	£4,000 - £6,000	£48	C 74	C 74
2	Upgrade heating controls	£350 - £450	£93	C 76	C 77
3	Solar water heating	£4,000 - £6,000	£53	C 77	C 80
4	Replace single glazed windows with low- E double glazed windows	£3,300 - £6,500	£92	C 80	B 83
5	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£478	A 93	A 95

Choosing the right improvement package

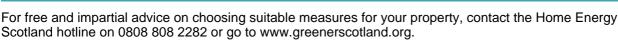



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

2 Heating controls (room thermostat and thermostatic radiator valves)

A room thermostat will increase the efficiency of the heating system by enabling the boiler to switch off when no heat is required; this will reduce the amount of energy used and lower fuel bills. Thermostatic radiator valves should also be installed, to allow the temperature of each room to be controlled to suit individual needs, adding to comfort and reducing heating bills provided internal doors are kept closed. For example, they can be set to be warmer in the living room and bathroom than in the bedrooms. Ask a competent heating engineer to install thermostatic radiator valves and a fully pumped system with the pump and the boiler turned off by the room thermostat. Thermostatic radiator valves should be fitted to every radiator except for the radiator in the same room as the room thermostat. Remember the room thermostat is needed to enable the boiler to switch off when no heat is required, thermostatic radiator valves on their own do not turn the boiler off. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

4 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	6,194	N/A	N/A	N/A
Water heating (kWh per year)	1,813			_

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Stephen Wallace Assessor membership number: ECMK302884

Company name/trading name: Walker Fraser Steele 27 Waterloo Street

Glasgow G2 6BZ

Phone number: 01412210442

Email address: stephen.wallace@walkerfrasersteele.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Scottish Single Survey



survey report on:

Property address	60 Glen Nevis Drive Dunfermline KY11 4QT
Customer	Aberdein Considine & Company
Customer address	8/9 Bon Accord Crescent Aberdeen AB11 6DN
Prepared by	Walker Fraser Steele
Date of inspection	29th August 2024

Walker Fraser Steele Chartered Surveyors

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A mid terrace two storey house.
Accommodation	Ground floor: entrance vestibule, lounge (with stairs leading up to upper floor) and kitchen/dining. First floor: two bedrooms, landing and bathroom.
Gross internal floor area (m²)	67 sqm gross ext.
Neighbourhood and location	Established residential area convenient for local amenities.
Age	Built circa 1980.
Weather	Dry/sunny.
Chimney stacks	Visually inspected with the aid of binoculars where
	appropriate.
	appropriate. Not applicable.
	Not applicable.
Roofing including roof space	
	Not applicable. Sloping roofs were visually inspected with the aid of
	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as

Visually inspected with the aid of binoculars where appropriate.		
Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The external walls are finished in roughcast render, measure approximately 300 mm thick and are assumed to be of timber frame construction. The entrance vestibule extension is of similar construction. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Communal areas Circulation areas visually inspected. Not applicable. Cutside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete	Rainwater fittings	
appropriate. Foundations and concealed parts were not exposed or inspected. The external walls are finished in roughcast render, measure approximately 300 mm thick and are assumed to be of timber frame construction. The entrance vestibule extension is of similar construction. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Carages and permanent outbuildings Visually inspected. Not applicable. Visually inspected. Front gardens hard landscaped with stone chippings and concrete		Rainwater fittings are formed in plastic.
appropriate. Foundations and concealed parts were not exposed or inspected. The external walls are finished in roughcast render, measure approximately 300 mm thick and are assumed to be of timber frame construction. The entrance vestibule extension is of similar construction. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Carages and permanent outbuildings Visually inspected. Not applicable. Visually inspected. Front gardens hard landscaped with stone chippings and concrete		
inspected. The external walls are finished in roughcast render, measure approximately 300 mm thick and are assumed to be of timber frame construction. The entrance vestibule extension is of similar construction. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Communal areas Circulation areas visually inspected. Not applicable. Carages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete	Main walls	
approximately 300 mm thick and are assumed to be of timber frame construction. The entrance vestibule extension is of similar construction. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Visually inspected. Font gardens hard landscaped with stone chippings and concrete		
keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Communal areas Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		approximately 300 mm thick and are assumed to be of timber frame construction. The entrance vestibule extension is of similar
keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Communal areas Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		
Doors and windows were not forced open. The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete	Windows, external doors and joinery	
The window frames are mainly single glazed timber framed and with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		Random windows were opened and closed where possible.
with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias provided. External decorations Visually inspected. Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		Doors and windows were not forced open.
Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		with one of UPVC with sealed unit double glazing. The doors are of UPVC with sealed unit double glazing. Softwood timber fascias
Painted smooth render window and door surrounds, sand concrete sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		
Sills. Painted external joinery. Conservatories / porches Visually inspected. Not applicable. Communal areas Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete	External decorations	Visually inspected.
Communal areas Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		
Communal areas Circulation areas visually inspected. Not applicable. Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete	Conservatories / porches	Visually inspected.
Outside areas and boundaries Not applicable. Visually inspected. Not applicable. Visually inspected. Front gardens hard landscaped with stone chippings and concrete	·	Not applicable.
Outside areas and boundaries Not applicable. Visually inspected. Not applicable. Visually inspected. Front gardens hard landscaped with stone chippings and concrete		
Garages and permanent outbuildings Visually inspected. Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete	Communal areas	Circulation areas visually inspected.
Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		Not applicable.
Not applicable. Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete		
Outside areas and boundaries Visually inspected. Front gardens hard landscaped with stone chippings and concrete	Garages and permanent outbuildings	Visually inspected.
Front gardens hard landscaped with stone chippings and concrete		Not applicable.
Front gardens hard landscaped with stone chippings and concrete	Outside areas and boundaries	Visually inspected.
		Front gardens hard landscaped with stone chippings and concrete

Ceilings	Visually inspected from floor level.
	Ceilings are of plasterboard.
	T
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls and partitions are of lightweight construction. The walls and partitions are finished with plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	The first floor of suspended timber construction. Ground floor of solid concrete.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen fittings comprise a range of wall and base units with laminate worktops. Softwood timber panelled interior doors fitted.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	Not applicable.
Internal decorations	Visually inspected.
	Emulsion painted surfaces.
Cellars	Visually inspected where there was a safe and purpose-built
	access.
	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains electricity is connected with the meter and the consumer unit in the entrance vestibule cupboard.


Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains gas supply is connected with a meter in purpose built external box on the front wall.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains water supply is connected. White ceramic and plastic sanitary fittings installed. Mains connected shower over the bath.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Central heating is provided by a wall mounted gas fired combination boiler in the kitchen cupboard supplying radiators.
Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is assumed to connect into the public sewer.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	Mains connected smoke alarms fitted.
Any additional limits to inspection	For flats / maisonettes
	Only the subject flat and internal communal areas giving access to the flat were inspected.
	If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.
	The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

When visually inspected the property insulation was not disturbed, furniture and personal effects (particularly in cupboards) and floor coverings have not been moved.

Only a head and shoulders inspection of the roof space was possible due to the presence of insulation which prevents safe access.

The heating system and gas and electricity appliances and supplies were not tested. All services were isolated /turned off/drained down.

Sectional Diagram showing elements of a typical house

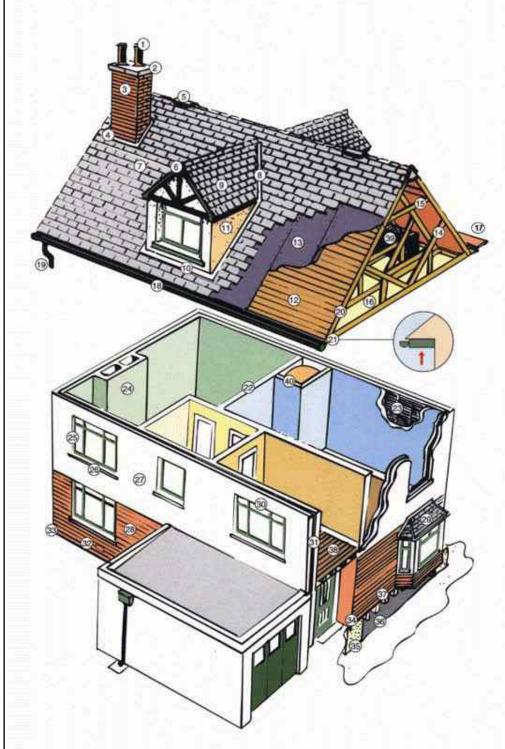

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9) Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 7) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 0) Verge boards /skews
- (21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- 26) Window sills
- (27) Rendering
- (28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 9) Water tank
- (40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	No evidence of significant structural movement was noted affecting the property within the limitations and scope of the inspection and report.

Dampness, rot and infestation	
Repair category	1
Notes	There is no evidence indicating any significant dampness, rot or infestation within the limitations and scope of the inspection and report.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	2
Notes	There are no obvious or significant defects affecting the roof coverings. heavy moss growth noted to roof tiles. Inadequate levels of insulation in roof void to meet modern standards.

Rainwater fittings	
Repair category	2
Notes	Vegetation growth/moss noted to gutters.

Main walls	
Repair category	1
Notes	There are no obvious or significant effects affecting the main walls. Sections of the render are noted to be marked and weathered.

Windows, external doors and joinery	
Repair category	2
Notes	Localised rotted/damaged timbers to dated single glazed window units.

External decorations	
Repair category	2
Notes	Paintwork to external components is peeling/weathering.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	2
Notes	Outside areas are suffering from a lack of maintenance/attention.

Ceilings	
Repair category	1
Notes	There are no obvious or significant defects affecting ceilings.

Internal walls	
Repair category	1
Notes	There are no obvious or significant defects affecting the internal walls.

Floors including sub-floors	
Repair category	1
Notes	There are no obvious or significant defects affecting flooring. Localised uneven floor surfaces. Localised loose floor boards noted.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Internal joinery is affected by wear and tear. The kitchen units suffering from wear and tear and considered rather dated by present day standards.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	2
Notes	Wear and tear to interior decorative surfaces throughout.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	1
Notes	It is recommended that all electrical installations be checked every five years to keep up to date with frequent changes in safety regulations.

Gas	
Repair category	1
Notes	There is no obvious defects affecting the gas installation but this should be confirmed by an approved Gas Safe contractor.

Water, plumbing and bathroom fittings				
Repair category	1			
Notes	There are no obvious defects affecting the visible plumbing apparatus. There are no obvious reportable defects affecting sanitary ware. Dated but functional bathroom suite.			

Heating and hot water			
Repair category	2		
Notes	We found no signs of any significant disrepair to the central heating or radiators although as the system was not tested, this being out with our remit we cannot comment on its effectiveness. Service records should be transferred. Boiler requires re pressurisation when turned back on.		

Drainage	
Repair category	1
Notes	There are no obvious defects affecting the foul or surface water drainage systems.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	-
Internal decorations	2
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes X No
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property is assumed to be held in 'Absolute Ownership' and unaffected by any onerous burdens or title restrictions.

The property is accessed by a shared entrance and car park. Confirm ownership of same and rights of access. The valuation assumes there are no onerous restrictions or liabilities.

Estimated reinstatement cost for insurance purposes

£145,000 (ONE HUNDRED AND FORTY FIVE THOUSAND POUNDS).

Valuation and market comments

£130,000 (ONE HUNDRED AND THIRTY THOUSAND POUNDS).

Signed	Security Print Code [516045 = 6182] Electronically signed
Report author	S Wallace
Company name	Walker Fraser Steele
Address	Cadell House, 23-31 Waterloo Street, Glasgow, G2 6BZ
Date of report	29th August 2024

Walker Fraser Steele Chartered Surveyors

Property Address	
Address Seller's Name Date of Inspection	60 Glen Nevis Drive, Dunfermline, KY11 4QT Aberdein Considine & Company 29th August 2024
Property Details	
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block □ Low rise block □ Other (specify in General Remarks)
Does the surveyor bell e.g. local authority, mi	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes only Approximate Year of 0	No. of units in block
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 2 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 1 WC(s) 0 Other (Specify in General remarks)
	cluding garages and outbuildings)
Garage / Parking / 0	Outbuildings
Single garage Available on site?	□ Double garage X Parking space □ No garage / garage space / parking space X Yes □ No
Permanent outbuilding	gs:
None.	

Construction							
Walls	Brick	Stone	Concrete	X Timber frame	Othe	r (specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	Othe	r (specify in Gen	eral Remarks)
Special Risks							
Has the property	suffered struc	tural movem	ent?			Yes	X No
If Yes, is this rece	nt or progress	sive?				Yes	No
Is there evidence, immediate vicinity	•	ason to antic	ipate subsidence	, heave, landslip o	r flood in the	e Yes	X No
If Yes to any of th	e above, prov	ride details in	General Remark	KS.			
Service Connec	ctions						
Based on visual ir of the supply in G			ices appear to be	e non-mains, pleas	e comment	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description of	of Central Hea	ating:					
Gas fired boiler t	to radiators.						
Site							
Apparent legal iss	sues to be ver	ified by the c	onveyancer. Ple	ase provide a brief	f description	in General R	emarks.
Rights of way	X Shared driv	es / access	Garage or other	amenities on separate	site Sha	red service conn	ections
Ill-defined boundar	ries	Agricu	tural land included w	ith property	Othe	er (specify in Ger	neral Remarks)
Location							
X Residential suburb	Re	sidential within t	own / city Mix	ed residential / commer	cial Mair	nly commercial	
Commuter village	Re	mote village	Isol	ated rural property	Othe	er (specify in Gei	neral Remarks)
Planning Issues	s						
Has the property been extended / converted / altered? Yes X No If Yes provide details in General Remarks.							
Roads							
X Made up road	Unmade roa	d Partiv	completed new road	Pedestrian a	ccess only	Adopted	Unadopted

General Remarks					
Established residential area convenient for local amenities.					
The property is accessed by a shared entrance and car park. Confirm ownership of same and rights of access. The valuation assumes there are no onerous restrictions or liabilities.					
The general condition of the property appears consistent with its age and type of construction, but some works of repair and maintenance are required. elements of the property are ageing and likely to require attention.					
Essential Repairs					
None required for mortgage purposes.					
Estimated cost of essential repairs £ Retention recommended? Yes X No Amount £					

Comment on Mortgageability					
In our opinion the subjects	s would form suitable mortgage security by a lending institution.				
Valuations					
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?					
Buy To Let Cases					
month Short Assured Tenai	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? here there is a steady demand for rented accommodation of this type?	£ Yes No			
Declaration					
Signed Surveyor's name	Security Print Code [516045 = 6182] Electronically signed by:- S Wallace				
Professional qualifications	MRICS				
Company name	Walker Fraser Steele				
Address	Cadell House, 23-31 Waterloo Street, Glasgow, G2 6BZ				
Telephone	0141 221 0442				
Fax	0141 258 5976				
Report date	29th August 2024				

Sellers Property Questionnaire



Property address	60 GLEN NEVIS DRIVE, DUNFERMLINE, KY11 4QT
Seller(s)	Aberdein Considine
Completion date of property questionnaire	23/08/2024

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the property? Cannot answer*					
2.	Council tax					
	Which Council Tax band is your property in? (Please circle)					
	A B C D E F G H Cannot answer*					
3.	Parking					
	What are the arrangements for parking at your property?					
	(Please tick all that apply)					
	• Garage					
	Allocated parking space					
	• Driveway					
	Shared parking					
	On street					
	Resident permit					
	Metered parking					
	Other (please specify):					
	Cannot answer*					
4.	Conservation area					
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? Yes / No / Don't know Cannot answer*					

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No Cannot answer*
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	Yes / No Cannot answer*
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes / Ne
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes / No Cannot answer*
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	(iii) Please describe the changes made to the windows, doors or patio doors (vidates when the work was completed):	vith approximate
	Please give any guarantees which you received for this work to your solicitor or	estate agent.

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / No / Partial Cannot answer*
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	
C.	Do you have a maintenance contract for the central heating system?	Yes / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No Cannot answer*
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes / No Cannot answer*
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes / Ne
b.	Are you aware of the existence of asbestos in your property?	Yes / No Cannot answer*
	If you have answered yes, please give details:	Carriot answer

10. a.	Services Please tick which services are	connected to yo	ur property and give detail	s of the
a.	supplier:	connected to yo	ar property and give detail	3 Of the
	Services	Connected	Supplier	
	Gas / liquid petroleum gas	Cannot answer*		
	Water mains / private water supply	Cannot answer*		
	Electricity	Cannot answer*		
	Mains drainage	Cannot answer*		
	Telephone	Cannot answer*		
	Cable TV / satellite	Cannot answer*		
	Broadband	Cannot answer*		
b.	Is there a septic tank system at you have answered yes, please		estions below:	Yes / No Cannot answer*
C.	(i) Do you have appropriate conse	nts for the discha	rge from your septic tank?	Yes / No / Den't knew
d.	(ii) Do you have a maintenance co	ntract for your se	otic tank?	Yes / No
	If you have answered yes, please have a maintenance contract:	e give details of the	ne company with which you	

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yos / No / Don't Know Cannot answer*
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Yes / No / Not applicable Cannot answer*
	If you have answered yes, please give details:	
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes / No Cannot answer*
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes / No Cannot answer*
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes / No Cannot answer*
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yes / No Cannot answer*
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yes / No Cannot answer*
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy?	Yes / No / Den't Knew Cannot answer*
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / Ne / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / No Cannot answer*
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes / No Cannot answer*
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for an	y of the	following	:			
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	Ne	Yes	Don't know	With title doods	Lost	Cannot Answer*
(iii)	Central heating	No	Yos	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	¥os	Don't know	With title doods	Lost	Cannot Answer*
(v)	Damp course	Ne	Yes	Don't know	With title doods	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas ite(s):	se give de	etails of t	he work		
C.	Are there any outstanding claims under any of the guarantees listed above? Yes / No If you have answered yes, please give details:				-/ No		
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years? If you have answered yes, please give details		roperty b	een move	ed in the	Don'	/ Ne / t know answer*

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Don't know Cannot answer*
b.	that affects your property in some other way?	Yos / No / Don't know Cannot answer*
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yos / No / Don't know Cannot answer*
	If you have answered yes to any of a-c above, please give the notices to your sagent, including any notices which arrive at any time before the date of entry of your property.	olicitor or estate the purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):		
Date:		

^{*} This report has been completed on behalf of the lender in respect to a repossessed property and therefore some information is not available.

