
HOME REPORT



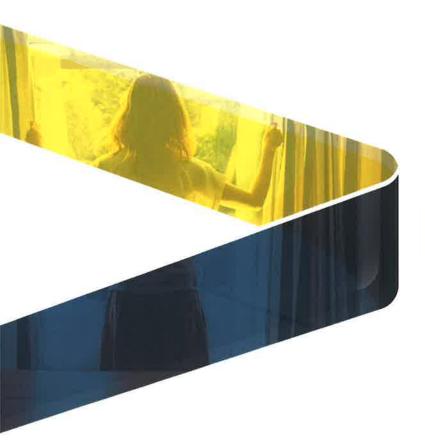

Home Report

Property: 49

Ross Avenue

Perth

Perth And Kinross

PH1 1GZ


Prepared for: Lesley Margaret Rutherford

Prepared by: Richard Lennon

Report reference: 1411151-1-2

Date of Report: 10/08/2022

ENERGY PERFORMANCE CERTIFICATE

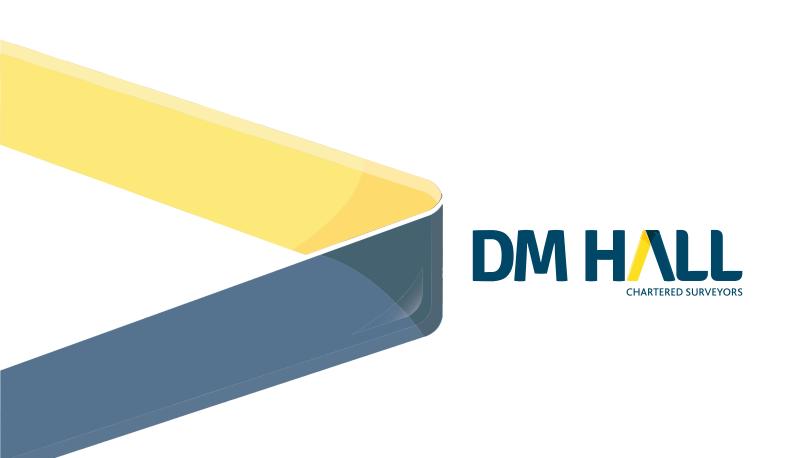

Energy Performance Certificate (EPC)

Dwellings

Scotland

49 ROSS AVENUE, PERTH, PH1 1GZ

Dwelling type:Detached houseDate of assessment:10 August 2022Date of certificate:12 August 2022

Total floor area: 206 m²

Primary Energy Indicator: 113 kWh/m²/year

Reference number: 0170-2860-9080-2592-4781 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,099	See your recommendations
Over 3 years you could save*	£114	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

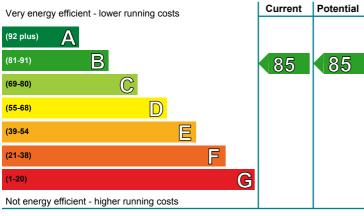


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band B (85)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

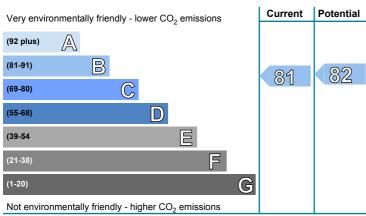

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (81)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Low energy lighting	£70	£111.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	****	****
Roof	Pitched, 200 mm loft insulation	****	★★★★ ☆
Floor	Suspended, insulated (assumed) To unheated space, insulated (assumed)	_ _	_ _
Windows	Fully double glazed	****	****
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★★ ☆
Secondary heating	Room heaters, mains gas	_	_
Hot water	From main system	****	★★★★ ☆
Lighting	Low energy lighting in 66% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 20 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.1 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,280 over 3 years	£2,295 over 3 years	
Hot water	£321 over 3 years	£321 over 3 years	You could
Lighting	£498 over 3 years	£369 over 3 years	save £114
Tota	ls £3,099	£2,985	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December and measures	Indicative cost	Typical saving	Rating after improvement	
Recommended measures	indicative cost	per year	Energy	Environment
1 Low energy lighting for all fixed outlets	£70	£37	B 85	B 82

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

Solar photovoltaics

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	14,947	N/A	N/A	N/A
Water heating (kWh per year)	2,546			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Richard Lennon

Assessor membership number: EES/009376

Company name/trading name: D M Hall Chartered Surveyors LLP Address: Gowrie House 52 Tay Street

Perth


PH1 5TR
Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

SINGLE SURVEY

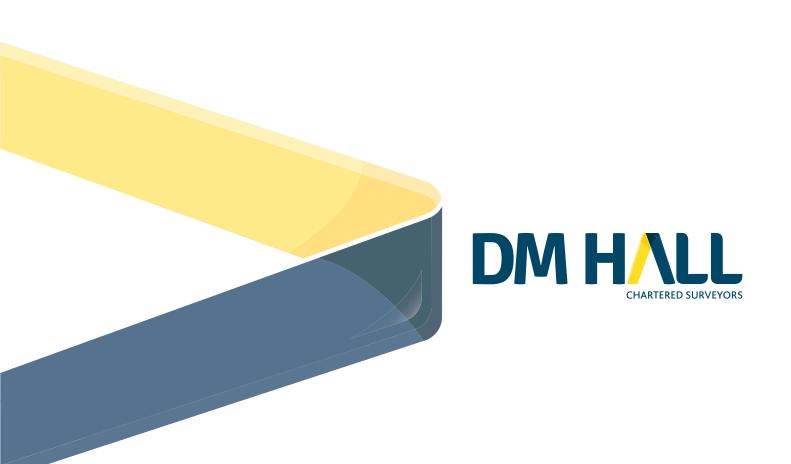

Schedule 1

Survey Report

49

Ross Avenue

Perth

Perth And Kinross

PH1 1GZ

Customer	Lesley Margaret Rutherford
Date of Inspection	10/08/2022
Prepared by	Richard Lennon

Address: 49 Ross Avenue, Perth, PH1 1GZ

Date of Inspection: 10/08/2022

DM Hall Reference: PE220746

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 2 of 15

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Detached split level two storey villa.
Accommodation	LOWER GROUND FLOOR Hall, Lounge, Open Plan Kitchen/Dining Room and Utility Room GROUND FLOOR Entrance Vestibule, Hall, Dining Room, Toilet MID FLOOR Hall, Master Bedroom with en-suite Shower Room with WC, Two further Bedrooms and Bathroom with WC FIRST FLOOR Hall, Study, Bedroom with en-suite Shower Room over the garage and Bedroom Five
Gross internal floor area (m^2)	Approximately 203 sq m
Neighbourhood and location	The property forms part of an established private residential area of similar type properties located to the south-west of the city centre. Transport, shopping and educational facilities are readily available.
Age	Approximately 14 years.
Weather	Dry and sunny following a period of generally mixed weather.
Chimney stacks	None.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor

DM Hall Reference: PE220746 Address: 49 Ross Avenue, Perth, PH1 1GZ

	deems it safe and reasonable to do so.
	The roof is pitched and tiled with tiled ridge and metal valleys and abutment flashings. There are solar panels on the rear pitch.
	The roof void is accessed via a drop down ladder and hatch in the mid bedroom. The roof is constructed of prefabricated timber trusses clad in timber sarking. The void is predominantly floored with insulation laid on top of the ceiling.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Gutters and downpipes are of PVC.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls comprise a structural timber frame with outer leaf of brick or block predominantly roughcast externally and part clad in synthetic stone. Sub floor vents are incorporated into the lower wall.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are of a PVC double glazed type provided with trickle ventilators.
	External doors are of a composite and PVC double glazed type.
	Soffit and fascia boards are of PVC.
External decorations	Visually inspected.
	Windows, doors and fascias are of PVC.
Conservatories/Porches	None.
Communal areas	None.
Garages and permanent outbuildings	Visually inspected

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Outside areas and boundaries	Visually inspected.
	There is garden ground surrounding the property bounded by post and panel fencing and stone walling.
Ceilings	Visually inspected from floor level.
	Ceilings are plasterboard lined.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are plasterboard lined. In addition, there is part tiling in the kitchen, utility room, toilet and shower rooms and part tiling and wet walling in the bathroom.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Flooring is of suspended timber joists.
	There is no known hatch.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored item were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery finishes are of timber.
	Interior doors are timber panelled and of timber and glass.
	The staircase is timber framed with timber treads and balustrade.
	The kitchen and utility room are provided with a range of fitted floor and wall mounted units.
	There are fitted wardrobes in four of the five bedrooms.
Chimney breasts and fireplaces	There is a gas fire in the lounge with balanced flue through the gable wall.
	Visually inspected.
Internal decorations	Visually inspected.
	Decor has a painted finish.

Address: 49 Ross Avenue, Perth, PH1 1GZ Date of Inspection: 10/08/2022

Electricity Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. From mains supply with meter and consumer unit located in the lower ground floor hall cupboard. Visible wiring is of PVC-coated cabling serving 13 amp sockets with circuit breakers. From mains supply with meter located in an external box. Gas Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards.If any services are turned off, the surveyor will state that in the report and will not turn them on. Water, plumbing and bathroom Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any fittings insulation. No tests whatsoever were carried out to the system or appliances. Water is from the public main. The toilet contains a white WC and wash hand basin. The shower rooms each contain a white WC, wash hand basin and shower cubicle. There is a three piece white suite comprising a WC, wash hand basin, and bath and separate shower cubicle in the bathroom. Visible pipework is formed in copper and PVC. There are stainless steel single drainer sink units in the kitchen and utility room. Accessible parts of the system were visually inspected Heating and hot water apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Space heating is provided by the gas-fired boiler located in the garage which supplies panel radiators fitted with thermostatic valves. The boiler also provides domestic hot water. The hot water cylinder is located in the mid floor hall cupboard. Drainage Drainage covers etc. were not lifted.

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 6 of 15

	Neither drains nor drainage systems were tested.
	Drainage is to the public sewer.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	There are smoke detectors located in the halls at each level together with a carbon monoxide detector in the lounge.
Any additional limits to inspection	The property is occupied and fully furnished with fitted floor coverings present.
	I have not disturbed insulation, furniture, personal effects (particularly in cupboards/wardrobes) and floor coverings have not been moved.
	No access was gained to the sub floor void.
	Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.
	Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.
	The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.
	Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves

Address: 49 Ross Avenue, Perth, PH1 1GZ

of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.


Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 8 of 15

Sectional diagram showing elements of a typical house:

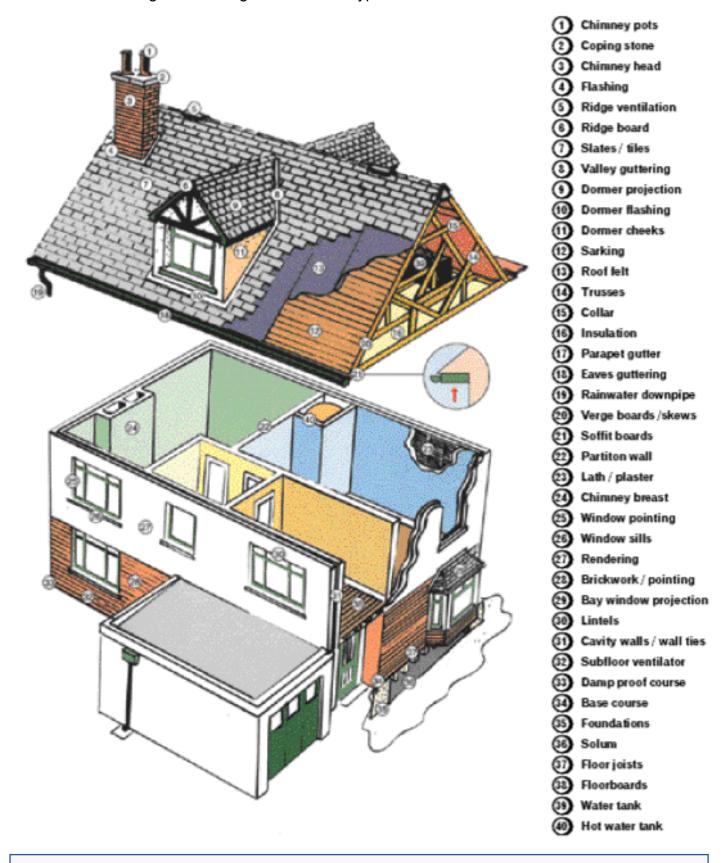

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

Address: 49 Ross Avenue, Perth, PH1 1GZ

Date of Inspection: 10/08/2022

DM Hall Reference: PE220746

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories.

Category 3	Category 2	Category 1
Urgent Repairs or replacement are	Repairs or replacement requiring	No immediate action or repair is
needed now. Failure to deal with	future attention, but estimates are	needed.
them may cause problems to other	still advised.	
parts of the property or cause a		
safety hazard. Estimates for repairs		
or replacement are needed now.		

Structural movement



Repair category:	1
Notes	No obvious evidence of significant movement noted within the limitations of

Dampness, rot and infestation



Repair category:	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney stacks



Repair category:	-
Notes	

Roofing including roof space



Repair category:	1
Notes	There are valley gutters. These can be problematic and maintenance should be undertaken regularly.
	There is moss to roof tiles which can be brushed off.

Rainwater fittings



Repair category:	2
Notes	Sections of guttering require to be cleared of vegetation. I understand that this will be done prior to sale.

Main walls



Repair category:	2
Notes	There is some cracking to roughcast which can be pointed by a competent local builder.

Windows, external doors and joinery



Repair category:	1
Notes	Periodic maintenance should be anticipated to window and door mechanisms.

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 10 of 15

External decorations



Repair category:

Notes No significant defects evident.

Conservatories/porches



Repair category:

Notes

Communal areas



Repair category:

Garages and permanent outbuildings



Repair category: 1

Notes No significant defects evident.

Outside areas and boundaries



Repair category:

Notes The stone boundary wall requires some repair.

Ceilings



Repair category: 1

Notes No significant defects evident.

Internal walls



Repair category: 1

Notes No significant defects evident.

Floors including sub-floors



Repair category:

NotesIt is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments.

Internal joinery and kitchen fittings



Repair category:

NotesGlazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.

Chimney breasts and fireplaces



Repair category:

NotesAll gas fires should be tested for safety prior to use by a Gas Safe registered contractor.

Internal decorations



Repair category: 1

Notes No significant defects evident.

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 11 of 15

Cellars



Repair category:	
Notes	

Electricity

Repair category:	1
Notes	lt

It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a gualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas



Repair category:	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing and bathroom fittings



_	-			
	nair	categ	ON	
VE	vali	caleu	UI V	<i>.</i>

Notes

Seals around bath/shower areas are frequently troublesome and require to be checked regularly.

Heating and hot water



D	Δr	۱ai	rc	ate	~	r	, -	
1	ヘニト	Jai	ı	alt	yu	יי у	-	

Notes

It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with

the relevant regulations.

Boilers and central heating systems should be tested and serviced by a Gas Safe registered contractor on an annual basis to ensure their safe and efficient operation.

The central heating boiler is of an older design. Informed opinion suggests that boilers have a life expectancy between 10 and 20 years depending on the quality of the boiler and whether or not regular maintenance has been carried out. Future repair or replacement should be anticipated.

Drainage



Repair category:	1
Notes	No significant defects evident.

Page **12** of **15** DM Hall Reference: PE220746 Address: 49 Ross Avenue, Perth, PH1 1GZ

Summary:

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Category 3

Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Structural Movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember:

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 13 of 15

3. ACCESSIBILITY INFORMATION

Guidance notes on Accessibility Information:

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes; parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1	Which floor(s) is the living accommodation on?	Lower Ground Floor, Ground Floor, Mid and First Floor
2	Are there three steps or fewer to a main entrance door of the property?	Yes
3	Is there a lift to the main entrance door of the property?	No
4	Are all door openings greater than 750mm?	No
5	Is there a toilet on the same level as the living room and kitchen?	Yes
6	Is there a toilet on the same level as a bedroom?	Yes
7	Are all rooms on the same level with no-internal steps or stairs?	No
8	Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 14 of 15

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes

Matters for a solicitor or licensed conveyancer:

The property is fitted with solar/photovoltaic panels. All documentation relating to the system should be obtained so that the transfer of ownership can be carried out as part of the conveyancing process. It should be confirmed that there are no outstanding financial liabilities or contracts attached to the property.

Estimated re-instatement cost for insurance purposes:

£550,000 (Five Hundred and Fifty Thousand Pounds)

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments:

£450,000 (Four Hundred and Fifty Thousand Pounds) The reported valuation is a snapshot in time and reflects the prevailing market conditions. The market is presently characterised by a limited supply of property and a disproportionate high demand which is resulting in premium prices being achieved in some instances. The prices being paid and the reported valuation figure may not be sustainable if market conditions change.

Signed: Electronically by Richard Lennon

Report author: Richard Lennon

Company name DM Hall (Perth)

Address: Gowrie House, 52 Tay Street, Perth, PH1 5TR

Date of report: 12/08/2022

Address: 49 Ross Avenue, Perth, PH1 1GZ

DM Hall Reference: PE220746

Page 15 of 15

Mortgage Valuation Report

49 Ross

Ross Avenue

Perth

Perth And Kinross

PH1 1GZ

Seller's Name:	Lesley Margaret Rutherford
Date of Inspection:	10/08/2022
Prepared by:	Richard Lennon

Address: 49 Ross Avenue, Perth, PH1 1GZ Date of Inspection:10/08/2022

DM Hall Reference: PE220746

1. Property Details	
Property type:	House
Floor(s) on which located (Flat or maisonettes only):	
Number of floors in block (Flat or maisonettes only):	
Number of units in block (Flat or maisonettes only):	
Is there a lift provided? (Flat or maisonettes only):	
Property style:	Detached
Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?	No
Approximate year of construction:	2008

2. Tenure	
Tenure:	Absolute Ownership
Ground rent:	
Unexpired years:	

3. Accommodation	
Number of living rooms:	2
Number of bedrooms:	5
Number of kitchens:	1
Number of Bathrooms	3
Number of water closets:	4
Other Rooms:	Study and Utility Room.
Internal gross floor area (excluding garages and outbuildings):	203m²
External gross floor area (excluding garages and outbuildings):	233m²
Does the property have a residential element greater than 40%?	Yes

4. Garage / Parking / Outbuildings	
Parking type:	Double garage
Available on site?	Yes
Permanent Outbuildings:	None

5. Construction	
Main wall type:	Timber frame
Other (please specify):	
Roof type:	Tile
Other (please specify):	

6. Special Risks	
Has the property suffered structural movement?	No
Is this recent or progressive?	
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the	No

Address: 49 Ross Avenue, Perth, PH1 1GZ Date of Inspection:10/08/2022

DM Hall Reference: PE220746 Page 2 of 4

immediate vicinity?				
If yes, please specify any of the abo	ve:			
7 0 : 0				
7. Service Connections		a ha man maina mlass		
the supply in the 'brief description of ce			se comment on the type and location of	
Drainage:	ona di madang ada	Mains		
Electricity:		Mains		
Central Heating:		Yes		
Water:		Mains		
Gas:		Mains		
Brief description of central heating	ng:	Gas-fired boiler to ra	diators	
·	J			
8. Site				
Apparent legal issues to be verified by	the conveyancer			
Legal Issue	Ver	ification	Description	
Rights of way:				
Shared drives / access:				
Garage or other amenities on separate site:				
Shared service connections:				
III-defined boundaries:				
Agricultural land included with property:				
Other:				
9. Location				
Location type:		Residential within to	wn/city	
Other (if not specified):				
10 Planning leaves				
10. Planning Issues Has the property been extended / co				
Tias life Diobelly beell extellued / CO	nverted /	No		
altered?	onverted /	No		
		No		

11. Roads
Roads that relate to the property:

Adopted

12. General Remarks General remarks on the property: CONDITION The property has been well maintained with only cosmetic items of defect noted capable of remedy with routine maintenance.

Address: 49 Ross Avenue, Perth, PH1 1GZ

REMARKS

The property is fitted with solar/photovoltaic panels. All documentation relating to the system should be obtained so that the transfer of ownership can be carried out as part of the conveyancing process. It should be confirmed that there are no outstanding financial liabilities or contracts attached to the property.

13. Essential Repairs	
Information relating to essential repairs for the property:	
Estimated cost of essential repairs:	
Retention recommendation?	
Amount:	

14. Comment on Mortgageability	
Information relating to mortgageability of the	The property should form a suitable security for mortgage
property:	purposes at the figure of value outlined below.

15. Valuations	
Market value in present condition:	£450,000.00
Market value on completion of essential repairs:	
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£550,000.00
Is re-inspection necessary?	No

Signed: Electronically by Richard Lennon

Report author: Richard Lennon

Company name: DM Hall (Perth)


Address: Gowrie House, 52 Tay Street, Perth, PH1 5TR

Date of report: 12/08/2022

Address: 49 Ross Avenue, Perth, PH1 1GZ Date of Inspection:10/08/2022

Page 4 of 4

PROPERTY QUESTIONNAIRE

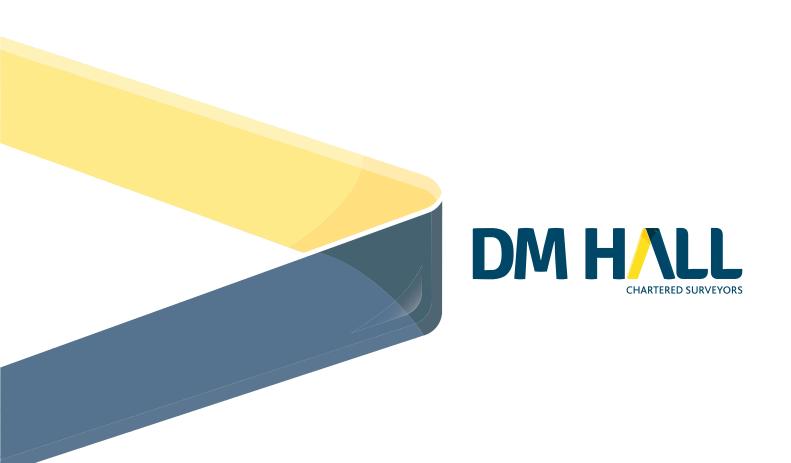

Property Questionnaire

49

Ross Avenue

Perth

Perth And Kinross

PH1 1GZ

Property Address:	49 Ross Avenue Perth Perth And Kinross PH1 1GZ
Seller(s):	Lesley Margaret Rutherford
Completion date of Property Questionnaire:	05/08/2022

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1. Length of ownership		
How long have you owned the property?	14 years and 7 months	
2. Council Tax		
Which Council Tax band is your property in?	G	
3. Parking		
What are the arrangements for parking at your property?	Garage, Driveway, On street	
4. Conservation Area		
Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No	
5. Listed Buildings		
Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest?	No	
6. Alterations/additions/extensions		
a.	No	
(i). During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?		
If you have answered yes, please describe the changes which you have made:		
(ii). Did you obtain planning permission, building warrant, completion certificate and other consents for this work?		

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.	
b. Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	No
(i). Were the replacements the same shape and type as the ones you replaced?	
(ii). Did this work involve any changes to the window or door openings?	
(iii). Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed?	
Please give any guarantees which you received for this work to your solicitor or estate agent.	
7. Central Heating	
a. Is there a central heating system in your property?	Yes
Note: A partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).	
If you answered yes/partial:	Gas
What kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas, warm air).	
If you answered yes, please answer the following three questions:	
(i). When was your central heating system or partial central heating system installed?	At construction
(ii). Do you have a maintenance contract for the central heating system?	No
If you have answered yes, please give details of the company with which you have a maintenance agreement:	
(iii). When was your maintenance agreement last renewed? (Please provide the month and year).	

8. Energy Performance Certificate		
Does your property have an Energy Performance Certificate which is less than 10 years old?	No	
Note: The surveyor will provide this within their inspection.		
9. Issues that may have affected your property		
a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	No	
If you have answered yes, is the damage the subject of any outstanding insurance claim?		
b. Are you aware of the existence of asbestos in your property?	No	
If you have answered yes, please give details:		

10. Services

а

Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Yes	SSE Scottish Hydro
Water mains/private water supply	Yes	Scottish Water
Electricity	Yes	SSE Scottish Hydro
Mains drainage	Yes	Scottish Water
Telephone	Yes	Virgin
Cable TV/Satellite	Yes	
Broadband	Yes	Virgin
b. Is there a septic tank system in the p	roperty?	No
If you have answered yes, please ans		
(i). Do you have appropriate consenseptic tank?	ts for the discharge from your	

(ii). Do you have maintenance contract for your septic tank?	
If you have answered yes, please give details of the company with which you have a maintenance contract:	
11. Responsibilities for Shared or Common Areas	
Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	No
If you have answered yes, please give details:	
b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Not Applicable
If you have answered yes, please give details:	
C. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d. Do you have the right to walk over any of your neighbours' property - for example, to put out your rubbish bin or to maintain your boundaries?	No
If you have answered yes, please give details:	
e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	No
If you have answered yes, please give details:	
f. As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned).	No

If you have answered yes, please give details:	
12. Charges associated with your property	
a. Is there a factor or property manager for your property?	No
If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:	
b. Is there a common buildings insurance policy?	No
If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	
C. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Resident's Association, or maintenance or stair fund.	None
13. Specialist Works	
a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	No
If you have answered yes, please say what the repairs were for, whether they carried out the repairs (and when), or if they were done before you bought the property:	
b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	No
If you have answered yes, please give details:	
C. If you have answered yes to 13 (a) or (b), do you have any guarantees relating to this work?	
If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be	

shown in the original estimate.	
Guarantees are held by:	
44 Occamenta de	
14. Guarantees	
a. Are there any guarantees or warranties for any of the following?	
(i). Electrical work	No
(ii). Roofing	No
(iii). Central Heating	No
(iv). NHBC	No
(v). Damp course	No
(vi). Any other work or installations? (For example, cavity wall insulation, underpinning, indemnity policy)	No
b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
C. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details	No

15. Boundaries	
a. So far as you are aware, has any boundary of your property been moved in the last 10 years?	No
If you have answered yes, please give details:	
16. Notices that affect your property	
In the past 3 years, have you ever received a notice;	
a. advising that the owner of a neighbouring property has made a planning application?	No
b. that affects your property in some other way?	No
C. that requires you to do any maintenance, repairs or improvements to your property?	No

Notice:

If you have answered yes to any of a.-c. above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. 1

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

¹Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

Prior to 1st December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report² for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid.

Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

 the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from

ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3</u>: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2</u>: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 <u>Category 1</u>: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant

defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

DM Hall Offices

Aberdeen

01224 594172

Ayr

01292 286974

Cumbernauld

01236 618900

Cupar

01334 844826

Dumfries

01387 254318

Dundee

01382 873100

Dunfermline

01383 621262

Edinburgh

0131 477 6000

Elgin

01343 548501

Falkirk

01324 628321

Galashiels

01896 752009

Glasgow (North)

0141 332 8615

Glasgow (South)

0141 636 4141

Hamilton

01698 284939

Inverness

01463 241077

Inverurie

01467 624393

Irvine

01294 311070

Kirkcaldy

01592 598200

Livingston

01506 490404

Musselburgh

0131 665 6782

Oban

01631 564225

Paisley

0141 887 7700

Perth

01738 562100

Peterhead

01779 470220

Stirling

01786 475785

DMHALL.CO.UK





